

**REPUBLIC OF LEBANON
COUNCIL FOR DEVELOPMENT & RECONSTRUCTION**



**Lebanon Emergency Assistance Project
(LEAP)**

**Rehabilitation of Schools–Shelters
“LEAP-SH-SW-MEHE- Batch 1 (Lot 1)”**

**Assessment Report - Activity A2
Schools Findings, Location Maps &
Photographs**

Prepared By:

Ref. L2026-06
August, 2026

Lebanon Emergency Assistance Project (LEAP)

Tender Preparation and Construction Supervision For the Rehabilitation of Schools–Shelters

Assessment Report - Activity A2

Schools Findings, Location Maps & Photographs

School Site Assessment Findings and Documentation

Following the completion of the site assessment of all assigned schools, the findings and observations for each school are presented in the following sections. The purpose of this documentation is to provide a clear and comprehensive overview of the existing physical, structural, functional, and general condition of each school based on the site visits and visual assessments carried out by the assessment team.

For each assessed school, the information is organized systematically to facilitate identification of the school, understanding of its location and general characteristics, and evaluation of its current condition. The documentation for each school includes the school assessment sheet, location map, and photographic documentation.

The location map, obtained through Google Maps, provides a visual reference to the school's geographical position, while the photographs document the existing conditions observed during the site assessment and provide visual evidence supporting the findings recorded in the assessment sheet.

The assessment sheets are arranged according to the school serial number, allowing each school to be easily identified and cross-referenced with its corresponding maps and photographs. The following information is provided for each school:

1. School Identification and Location Information

The assessment starts with the basic identification details of the school, including:

- School serial number;
- School name;
- CERD number;
- Governorate and district;
- School location and geographical coordinates, including the X and Y coordinates.

The coordinates are provided to accurately identify the school's geographical location and facilitate its reference on the corresponding location map.

2. General School and Building Information

General information regarding the school premises and its physical configuration is then provided. This includes the ownership status of the property, indicating whether the school building is owned or rented, as well as the number of building blocks, number of floors, and number of classrooms within the premises.

This information is important for understanding the overall size and configuration of the school and for establishing the context in which the technical condition of the buildings and facilities has been assessed.

3. School Administration and Contact Information

The name of the school director or responsible administrator is recorded together with the available telephone number or other contact details. This information provides a reference for communication and, where necessary, for clarification of specific observations or issues identified during the assessment.

4. Technical Assessment of the Existing Condition

A detailed description of the technical condition of the school is provided based on the visual assessment undertaken during the site visit. The assessment considers the observable condition of the main building components and facilities, as applicable, including the general condition of the buildings, structural elements, roofs, walls, floors, doors and windows, electrical and plumbing installations, sanitary facilities, water supply and drainage systems, and other relevant school infrastructure.

The assessment is primarily based on visual inspection and observations made during the site visit. It is intended to document visible defects, deterioration, deficiencies, damage, maintenance requirements, and other conditions that may affect the functionality, safety, usability, or overall condition of the school facilities. Where relevant, the findings are supported by photographs included in the school documentation.

5. Special Remarks and Observations

At the end of each assessment sheet, special remarks and observations are provided to record specific conditions or issues that require particular attention. These remarks may include unusual site conditions, significant defects, accessibility concerns, urgent maintenance requirements, restrictions encountered during the assessment, or other observations that may not be fully reflected in the standard assessment categories.

School List

The following table presents the list of schools, including the serial number, school name, CERD number, and governorate/district location.

LEAP-SH-SW-MEHE- Batch 1
Lot 1 – Akkar Governorate + Zgharta District (23 Schools)

School No.	School Name	CERD No.	Governorate / District
21	Rafik Hariri Mixed Public School - Bebnine ثانوية الشهيد رفيق الحريري الرسمية المختلطة - ببنين	554	Akkar
22	Mohamad Kheir eldine El Rifai Public School مدرسة المربي محمد خير الدين الرفاعي الرسمية للصبيان	555	Akkar
24	Karkaf Mixed Public School مدرسة القرقف الرسمية المختلطة	562	Akkar
26	Berqayel Secondary Public School ثانوية برقاييل الرسمية للبنين	565	Akkar
27	Qobait Mixed Public School مدرسة قبيعت الرسمية المختلطة	569	Akkar
42	Meshmesh Mixed Public School مدرسة مشمش الرسمية المختلطة	618	Akkar
43	Fnaydek Mixed Public School تكميلية فنيديك المختلطة الرسمية	621	Akkar
44	El Qorneh Mixed Public School مدرسة القرنة المختلطة الرسمية	625	Akkar
46	Hrar Mixed Public School مدرسة حرار المختلطة الرسمية	629	Akkar
47	Ouyoun El Samak Mixed Public School مدرسة عيون السمك الرسمية المختلطة	631	Akkar
48	Shan Mixed Public School مدرسة شان الرسمية المختلطة	633	Akkar
49	El Houweish Mixed Public School مدرسة الحويش الرسمية المختلطة	634	Akkar
55	El Kafroun Mixed Public School مدرسة الكفرون الرسمية المختلطة	1332	Akkar
56	El Houweish Mixed Public School تكميلية الحويش الرسمية المختلطة	1334	Akkar
57	Hrar Mixed Public School ثانوية حرار المختلطة الرسمية	1390	Akkar
64	EL Mouhammara Mixed Public School مدرسة المحمرة الرسمية المختلطة	1583	Akkar
67	Berqayel Public School ثانوية برقاييل الرسمية للبنات	1612	Akkar
71	Hilan Mixed Public School مدرسة حيلان الرسمية المختلطة	666	North / Zgharta
72	El Fawar Mixed Public School مدرسة الفوار الرسمية المختلطة	669	North / Zgharta
74	El Airounieh Mixed Public School مدرسة العيرونية الرسمية المختلطة	682	North / Zgharta
75	Mareh Kfarsghab Mixed Public School مدرسة مرج كفرصغاب الرسمية المختلطة	687	North / Zgharta
77	Mezyara Mixed Public School مدرسة مزيارة الرسمية المختلطة	694	North / Zgharta
78	Rashyin Mixed Public School ثانوية رشعين الرسمية المختلطة	1418	North / Zgharta

School No.	School Name	CERD No.	Governorate / District
21	Rafik Hariri Mixed Public School ثانوية الشهيد رفيق الحريري الرسمية المختلطة	554	Akkar

School Location:

X	Y
34.4928695	35.9995874

School Information:

Owned	Rented
✓	

No. of Blocks:

No. of Floors:

No. of Classrooms:

Director Name and Contact:

Najah Mohamad Al Rifai

- Landline:
- Mobile:

Building Condition: Category 1

Roof Heat Insulation:

Yes	No	Comments
✓		

Condition	
Good	To Repair
	✓

Roof Waterproofing:

Yes	No	Comments
✓		Type: SBS

Condition	
Good	To Repair
	✓

Presence of Parapet at Roof Floor:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Presence of Handicap Ramp at GF level:

Yes	No	Comments
	✓	

Condition	
Good	To Repair

Presence of Handicap Toilet:

Yes	No	Comments
	✓	

Condition	
Good	To Repair

Playground:

Yes	No	Comments
✓		


Condition	
Good	To Repair
✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Resin	Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Alum: silicone	Good	To Repair
					✓
Shed:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Source of Electricity:	EDL		Generator	Condition	
	✓			Good	To Repair
				✓	

Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
21	Rafik Hariri Mixed Public School - Bebnine ثانوية الشهيد رفيق الحريري الرسمية المختلطة - ببنين	554	Akkar

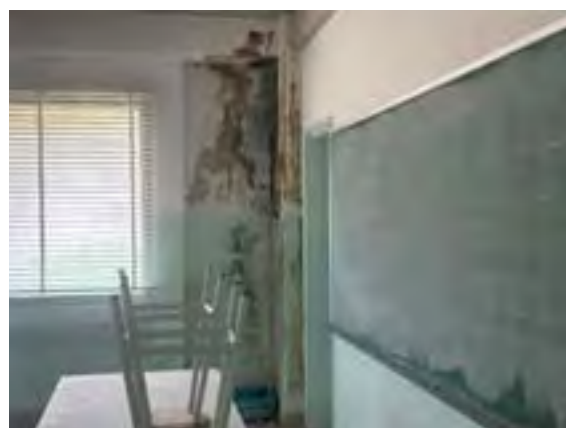

School No.	School Name	CERD No.	Governorate / District
21	Rafik Hariri Mixed Public School - Bebnine ثانوية الشهيد رفيق الحريري الرسمية المختلطة - ببنين	554	Akkar



School No.	School Name	CERD No.	Governorate / District
22	Mohamad Kheir eldine El Rifai Public School مدرسة المربي محمد خير الدين الرفاعي الرسمية للصبيان	555	Akkar

School Location:	X	Y
	34.4928439	35.9999586

School Information:	Owned	Rented	No. of Blocks:	1
	✓			
	No. of Floors:	4	No. of Classrooms:	32

Director Name and Contact:	Hania Mohamad El Tari	- Landline:	06-471991
		- Mobile:	70-607825

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓

Roof Waterproofing:	Yes	No	Comments	Condition	
	✓		Type: SBS	Good	To Repair
				✓	

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Playground:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Tiles	Good	To Repair
					✓

External Main Gate:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Internal Main Gate:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Shed:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓

Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Source of Electricity:	EDL		Generator	Condition	
			✓	Good	To Repair
				✓	


Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
22	Mohamad Kheir eldine El Rifai Public School مدرسة المربي محمد خير الدين الرفاعي الرسمية للصبيان	555	Akkar



School No.	School Name	CERD No.	Governorate / District
22	Mohamad Kheir eldine El Rifai Public School مدرسة المربي محمد خير الدين الرفاعي الرسمية للصبيان	555	Akkar

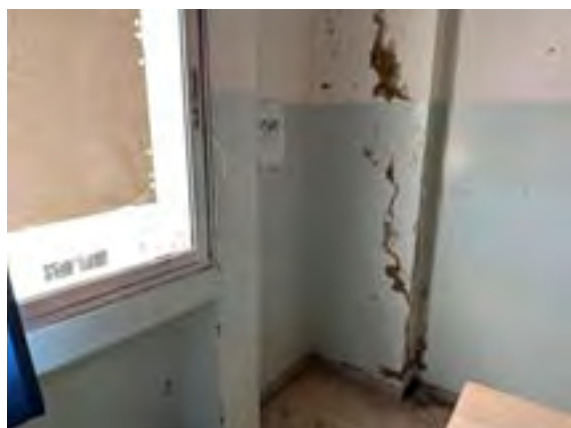

School No.	School Name	CERD No.	Governorate / District
24	Karkaf Mixed Public School مدرسة القرقف الرسمية المختلطة	562	Akkar

School Location:	X	Y
	34.4826408	36.0190694

School Information:	Owned	Rented	No. of Blocks:	1
	✓ (Gift)			
	No. of Floors:	2	No. of Classrooms:	18

Director Name and Contact:	Layal Abdel Salam Al Rifai	- Landline:	06-371679
		- Mobile:	03-429479

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
	✓		Type: SBS	Good	To Repair
				✓	

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Playground:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Drinking Fountain:

Yes	No	Comments
✓		Type: Resin

Condition	
Good	To Repair
✓	

External Main Gate:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Internal Main Gate:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Shed:

Yes	No	Comments
✓		T.O.T

Condition	
Good	To Repair
✓	

Rain Water System:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Waste Water Drainage System:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Electrical System:

Yes	No	Comments
✓		

Condition	
Good	To Repair
	✓

PV Solar Panel at Roof:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Source of Electricity:

EDL	Generator
✓	No

Condition	
Good	To Repair
✓	


Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
24	Karkaf Mixed Public School مدرسة القرقف الرسمية المختلطة	562	Akkar



School No.	School Name	CERD No.	Governorate / District
24	Karkaf Mixed Public School مدرسة القرقف الرسمية المختلطة	562	Akkar

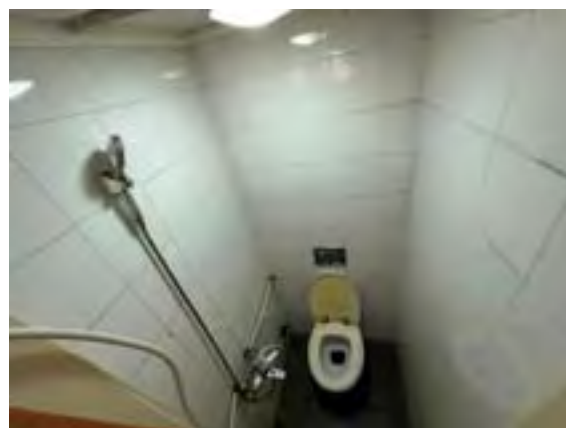

School No.	School Name	CERD No.	Governorate / District
26	Berqayel Secondary Public School ثانوية برقايل الرسمية للبنين	565	Akkar

School Location:

X	Y
34.4799734	36.0314467

School Information:

Owned	Rented	No. of Blocks:	1
	✓		

No. of Floors:	1	No. of Classrooms:	11
----------------	---	--------------------	----

Director Name and Contact:

Nahed Abeid

- Landline:	06-370230
- Mobile:	71-978355

Building Condition: Category 1

Roof Heat Insulation:

Yes	No	Comments
	✓	

Condition	
Good	To Repair

Roof Waterproofing:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Presence of Parapet at Roof Floor:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Presence of Handicap Ramp at GF level:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Presence of Handicap Toilet:

Yes	No	Comments
	✓	

Condition	
Good	To Repair

Playground:

Yes	No	Comments
✓		Type: concrete - slab on grade

Condition	
Good	To Repair
✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Porcelain	Good	To Repair
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
Shed:	Yes	No	Comments	Condition	
	✓		Type: Steel + fiber glass	Good	To Repair
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good	To Repair
Source of Electricity:	EDL		Generator	Condition	
	✓		No	Good	To Repair



Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.



School No.	School Name	CERD No.	Governorate / District
26	Berqayel Secondary Public School ثانوية برقاييل الرسمية للبنين	565	Akkar



School No.	School Name	CERD No.	Governorate / District
26	Berqayel Secondary Public School ثانوية برقaille الرسمية للبنين	565	Akkar

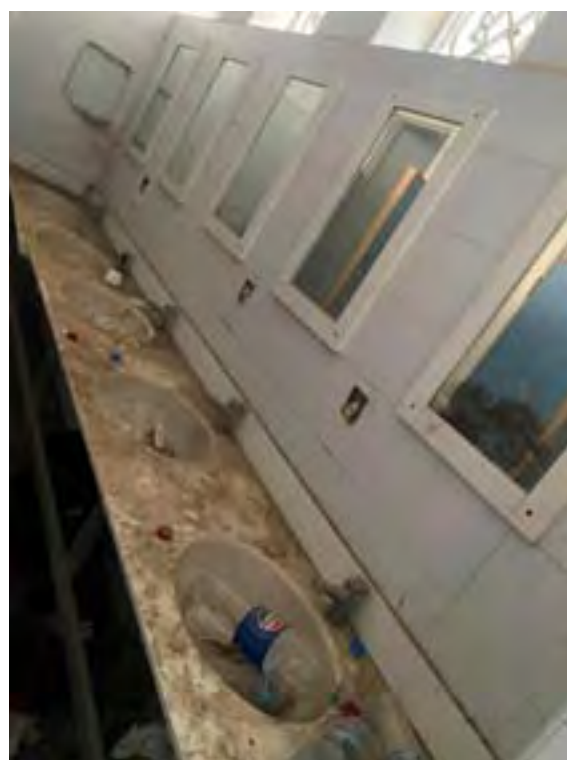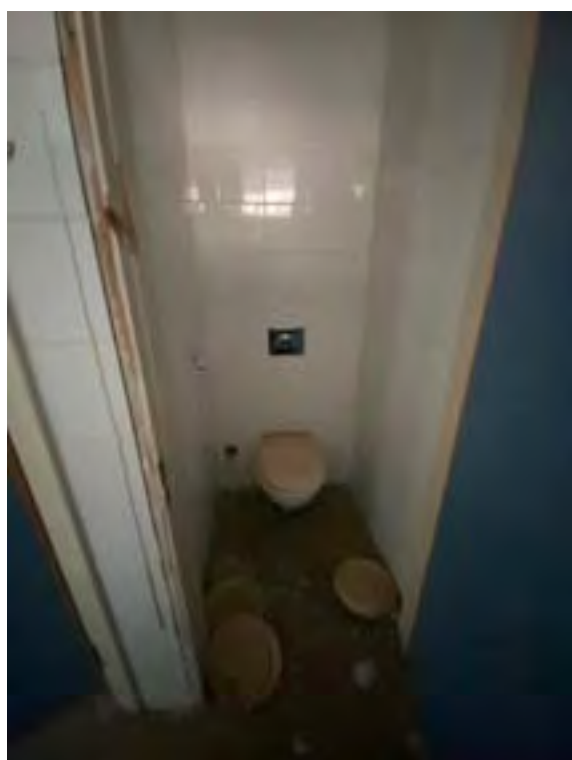

School No.	School Name	CERD No.	Governorate / District
26	Berqayel Secondary Public School ثانوية برقaille الرسمية للبنين	565	Akkar

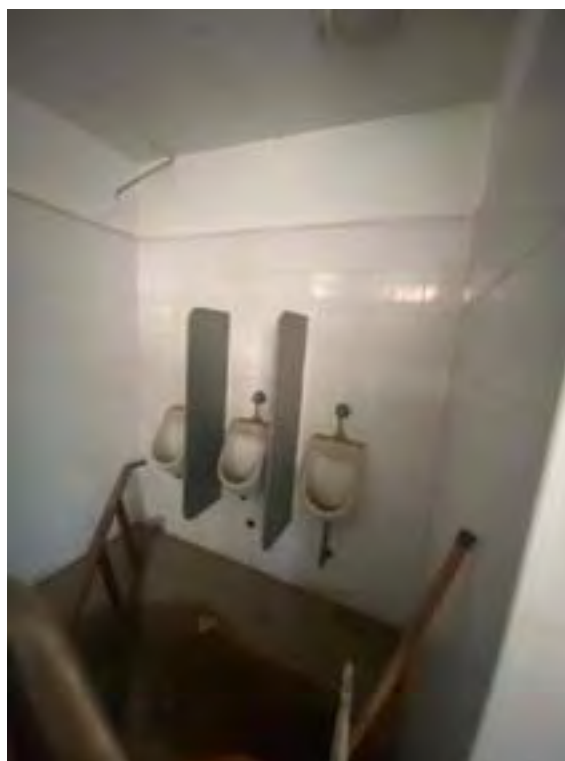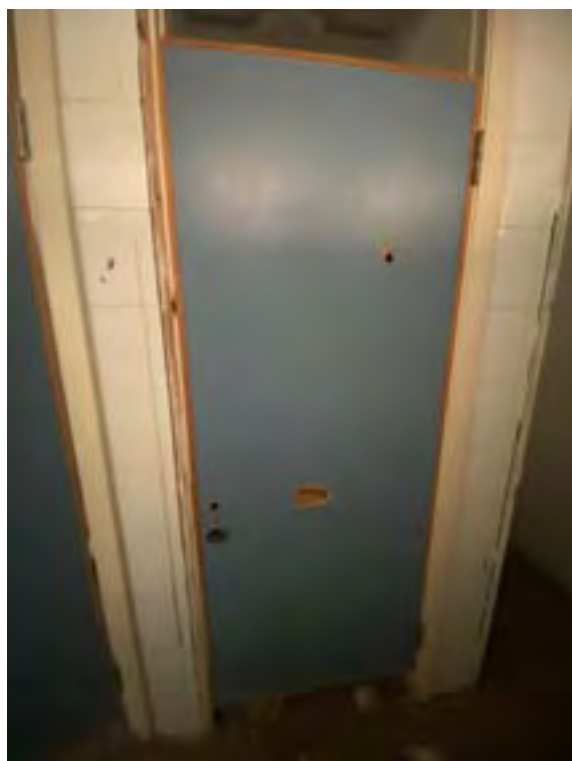

School No.	School Name	CERD No.	Governorate / District
27	Qobait Mixed Public School مدرسة قبييت الرسمية المختلطة	569	Akkar

School Location:	X	Y
	34.4517882	36.0965133

School Information:	Owned	Rented	No. of Blocks:	1
	✓ (Gift)			
	No. of Floors:	3	No. of Classrooms:	13

Director Name and Contact:	Mohamad Mahmoud Kanaan	- Landline:	06-865089
		- Mobile:	03-183977

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Playground:	Yes	No	Comments	Condition	
	✓		Slab on grade	Good	To Repair
				✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Porcelain	Good	To Repair
					✓
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Source of Electricity:	EDL		Generator	Condition	
	✓		Out of service	Good	To Repair
				EDL	Generator


Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
27	Qobait Mixed Public School مدرسة قبييت الرسمية المختلطة	569	Akkar



School No.	School Name	CERD No.	Governorate / District
27	Qobait Mixed Public School مدرسة قبييت الرسمية المختلطة	569	Akkar

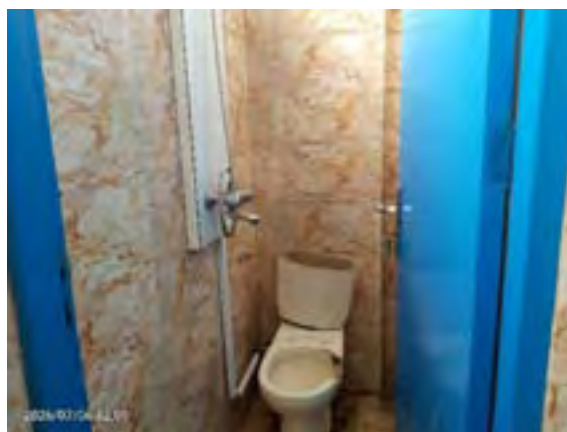

School No.	School Name	CERD No.	Governorate / District
42	Meshmesh Mixed Public School مدرسة مشمش الرسمية المختلطة	618	Akkar

School Location:

X	Y
34.4704207	36.1754547

School Information:

Owned	Rented
✓	

No. of Blocks:

No. of Floors:

No. of Classrooms:

Director Name and Contact:

Youssef Ali Berreh

- Landline:	06-895292
- Mobile:	03-132728

Building Condition: Category 1

Roof Heat Insulation:

Yes	No	Comments
	✓	

Condition	
Good	To Repair

Roof Waterproofing:

Yes	No	Comments
✓		Type: SBS

Condition	
Good	To Repair
	✓

Presence of Parapet at Roof Floor:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Presence of Handicap Ramp at GF level:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Presence of Handicap Toilet:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Playground:

Yes	No	Comments
✓		Slab on grade

Condition	
Good	To Repair
✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Carara	Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
					✓
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Rain Water System:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Source of Electricity:	EDL		Generator	Condition	
	✓		✓	Good	To Repair
				✓	



Remarks:

The urgent works include the replacement of the existing waterproofing membrane with a new one, the painting of the theatre's external walls with waterproof exterior paint, and the repair of the toilets' sewage system. The school is classified as **Category 1**, requiring urgent intervention and remedial works.

School No.	School Name	CERD No.	Governorate / District
42	Meshmesh Mixed Public School مدرسة مشمش الرسمية المختلطة	618	Akkar



School No.	School Name	CERD No.	Governorate / District
42	Meshmesh Mixed Public School مدرسة مشمش الرسمية المختلطة	618	Akkar

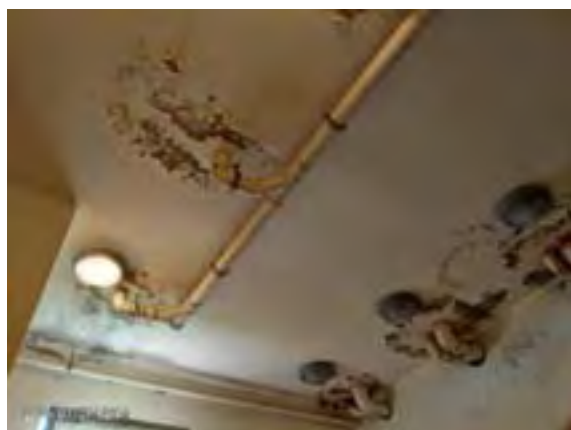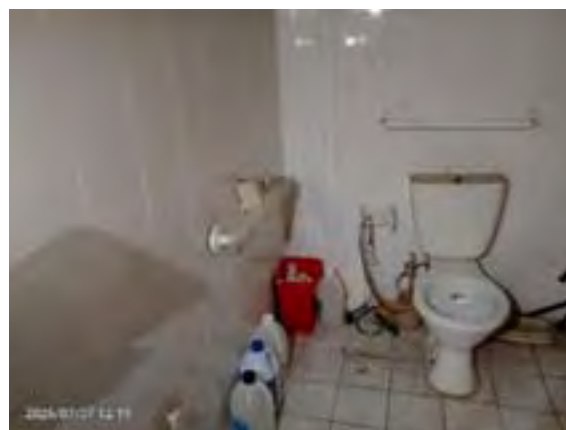

School No.	School Name	CERD No.	Governorate / District
43	Fnaydek Mixed Public School تكميلية فنيديك المختلطة الرسمية	621	Akkar

School Location:	X	Y
	34.4751393	36.1829556

School Information:	Owned	Rented	No. of Blocks:	1
	✓ (Gift)			
	No. of Floors:	3	No. of Classrooms:	59

Director Name and Contact:	Mohamad Ahmad Salah El Dine	- Landline:	06-895148
		- Mobile:	70-420850

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
	✓			Good	To Repair

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
				Good	To Repair

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
				Good	To Repair

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
				Good	To Repair

Playground:	Yes	No	Comments	Condition	
				Good	To Repair

Drinking Fountain:	Yes	No	Comments	Condition	
				Good	To Repair
External Main Gate:	Yes	No	Comments	Condition	
				Good	To Repair
Internal Main Gate:	Yes	No	Comments	Condition	
				Good	To Repair
Shed:	Yes	No	Comments	Condition	
				Good	To Repair
Rain Water System:	Yes	No	Comments	Condition	
				Good	To Repair
Waste Water Drainage System:	Yes	No	Comments	Condition	
				Good	To Repair
Electrical System:	Yes	No	Comments	Condition	
				Good	To Repair
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
				Good	To Repair
Source of Electricity:	EDL		Generator	Condition	
				Good	To Repair

Remarks:

The school is currently under rehabilitation by NRC, except for the listed part at the ground floor, which is outside the scope of the contractor's works. Based on the visual inspection, the school is classified as **Category 1**.

School No.	School Name	CERD No.	Governorate / District
43	Fnaydek Mixed Public School تكميلية فنيق المختلطة الرسمية	621	Akkar



School No.	School Name	CERD No.	Governorate / District
44	El Qorneh Mixed Public School مدرسة القرنة المختلطة الرسمية	625	Akkar

School Location:	X	Y
	34.4762109	36.1698129

School Information:	Owned	Rented	No. of Blocks:	2
		✓		
	No. of Floors:	3	No. of Classrooms:	29

Director Name and Contact:	Zaher Mahmoud Zakariya	- Landline:	06-895088
		- Mobile:	70-373871

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
	✓		Type: SBS	Good	To Repair

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Playground:	Yes	No	Comments	Condition	
	✓		Slab on grade	Good	To Repair

Drinking Fountain:	Yes	No	Comments	Condition	
			Closed by the school's admin	Good	To Repair
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
Shed:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓		14 panels	Good	To Repair
Source of Electricity:	EDL		Generator	Condition	
	✓		✓	Good	To Repair


Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment. Prior to the installation of the new SBS waterproofing membrane, all columns should be extended by providing the required column necks to ensure proper waterproofing detailing and continuity.

School No.	School Name	CERD No.	Governorate / District
44	El Qorneh Mixed Public School مدرسة القرنة المختلطة الرسمية	625	Akkar



School No.	School Name	CERD No.	Governorate / District
44	El Qorneh Mixed Public School مدرسة القرنة المختلطة الرسمية	625	Akkar

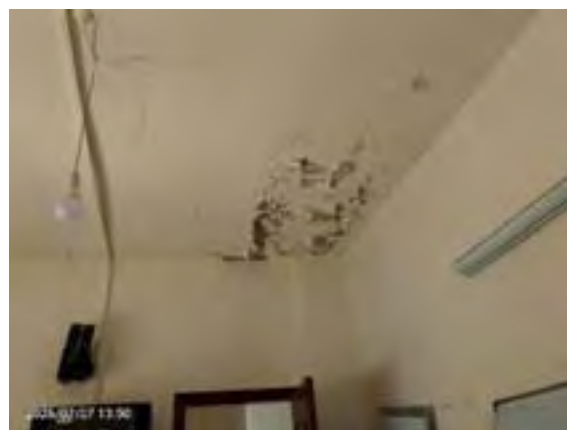

School No.	School Name	CERD No.	Governorate / District
46	Hrar Mixed Public School مدرسة حرار المختلطة الرسمية	629	Akkar

School Location:	X	Y
	34.4594507	36.1240276

School Information:	Owned	Rented	No. of Blocks:	1
	✓ (Gift)			
	No. of Floors:	4	No. of Classrooms:	31

Director Name and Contact:	Sharief Kassem Khodor	- Landline:	06-865039
		- Mobile:	07-1310148

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
	✓		Type: SBS	Good	To Repair ✓

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good ✓	To Repair

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
	✓			Good ✓	To Repair

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
	✓			Good ✓	To Repair

Playground:	Yes	No	Comments	Condition	
	✓		Slab on grade	Good ✓	To Repair

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Resin	Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good	To Repair
Source of Electricity:	EDL		Generator	Condition	
	✓		✓	Good	To Repair
				✓	

Remarks:


Based on the visual site assessment, the school is classified as Category 1, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

All external walls with stone cladding should be waterproofed due to the high water absorption of the stone, in order to prevent water infiltration and protect the building from moisture-related damage.

School No.	School Name	CERD No.	Governorate / District
46	Hrar Mixed Public School مدرسة حرار المختلطة الرسمية	629	Akkar



School No.	School Name	CERD No.	Governorate / District
46	Hrar Mixed Public School مدرسة حرار المختلطة الرسمية	629	Akkar

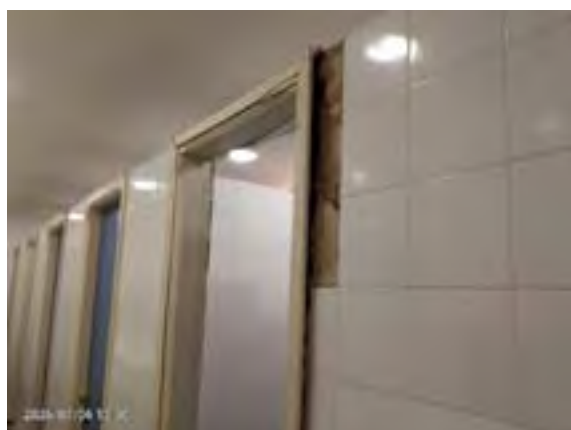

School No.	School Name	CERD No.	Governorate / District
47	Ouyoun El Samak Mixed Public School مدرسة عيون السمك الرسمية المختلطة	631	Akkar

School Location:

X	Y
34.4386455	36.00747

School Information:

Owned	Rented	No. of Blocks:	1
✓			

No. of Floors:	2	No. of Classrooms:	11
----------------	---	--------------------	----

Director Name and Contact:

Badiaa Mohamad Alam El
Din

- Landline:	06-240442
- Mobile:	71-841993

Building Condition: Category 1

Roof Heat Insulation:

Yes	No	Comments
	✓	

Condition	
Good	To Repair

Roof Waterproofing:

Yes	No	Comments
✓		Type: SBS With gravel

Condition	
Good	To Repair
	✓

Presence of Parapet at Roof Floor:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Presence of Handicap Ramp at GF level:

Yes	No	Comments
	✓	

Condition	
Good	To Repair

Presence of Handicap Toilet:

Yes	No	Comments
	✓	

Condition	
Good	To Repair

Playground:

Yes	No	Comments
✓		Slab on grade


Condition	
Good	To Repair
✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓		Requires configuration	Good	To Repair
					✓
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓		Insufficient, Battery & inverter don't work properly	Good	To Repair
				✓	
Source of Electricity:	EDL		Generator	Condition	
	✓			Good	To Repair
				✓	


Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
47	Ouyoun El Samak Mixed Public School مدرسة عيون السمك الرسمية المختلطة	631	Akkar

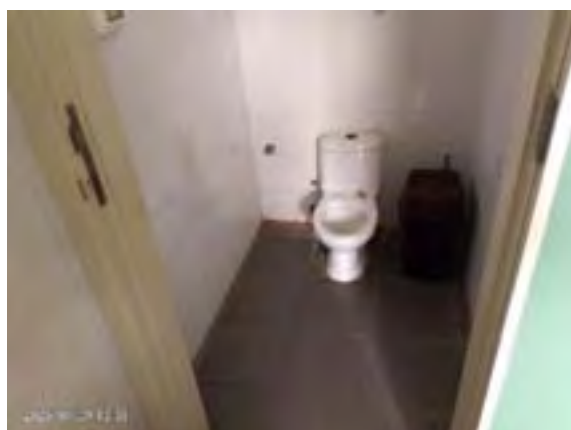

School No.	School Name	CERD No.	Governorate / District
47	Ouyoun El Samak Mixed Public School مدرسة عيون السمك الرسمية المختلطة	631	Akkar

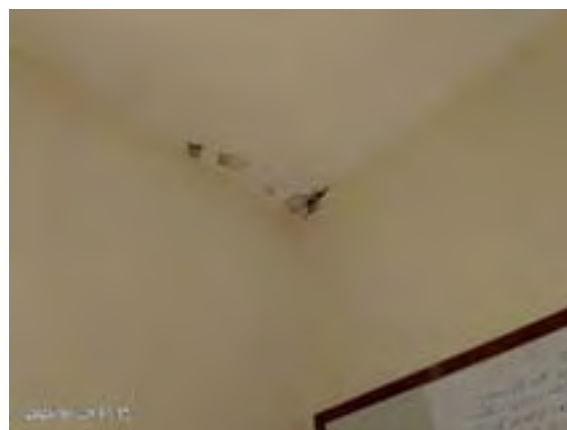

School No.	School Name	CERD No.	Governorate / District
48	Shan Mixed Public School مدرسة شان الرسمية المختلطة	633	Akkar

School Location:	X	Y
	34.4805846	36.11252

School Information:	Owned	Rented	No. of Blocks:	1
		✓		
	No. of Floors:	2	No. of Classrooms:	14

Director Name and Contact:	Kamel Khaled	- Landline:	06-865358
		- Mobile:	70-418597

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Playground:	Yes	No	Comments	Condition	
	✓		Slab on grade	Good	To Repair
				✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓			Type: Tiles	Good
External Main Gate:	Yes	No	Comments	Condition	
	✓				Good
Internal Main Gate:	Yes	No	Comments	Condition	
	✓				Good
Shed:	Yes	No	Comments	Condition	
		✓			Good
Rain Water System:	Yes	No	Comments	Condition	
	✓				Good
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓				Good
Electrical System:	Yes	No	Comments	Condition	
	✓				Good
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
		✓			Good
Source of Electricity:	EDL		Generator	Condition	
	No		✓	Good	To Repair


Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
48	Shan Mixed Public School مدرسة شان الرسمية المختلطة	633	Akkar



School No.	School Name	CERD No.	Governorate / District
48	Shan Mixed Public School مدرسة شان الرسمية المختلطة	633	Akkar

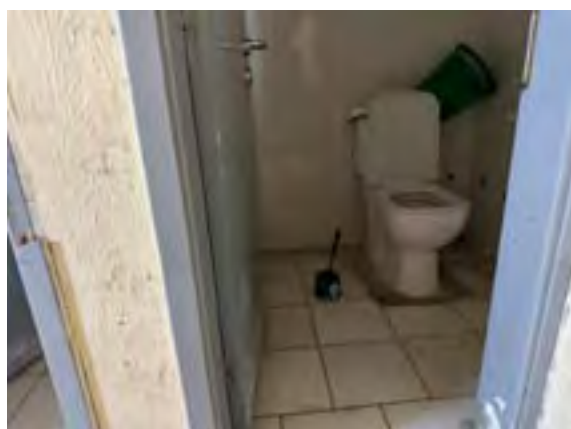

School No.	School Name	CERD No.	Governorate / District
49	El Houweish Mixed Public School مدرسة الحويش الرسمية المختلطة	634	Akkar

School Location:	X	Y
	34.4989404	36.1166879

School Information:	Owned	Rented	No. of Blocks:	1
		✓		
	No. of Floors:	3	No. of Classrooms:	13

Director Name and Contact:	Jack Tanous Shahine	- Landline:	06-865136
		- Mobile:	03-331949

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Playground:	Yes	No	Comments	Condition	
	✓		Slab on grade	Good	To Repair
				✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Tiles	Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Internal Main Gate:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Source of Electricity:	EDL		Generator	Condition	
			✓	Good	To Repair
				✓	

Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
49	El Houweish Mixed Public School مدرسة الحويش الرسمية المختلطة	634	Akkar



School No.	School Name	CERD No.	Governorate / District
55	El Kafroun Mixed Public School مدرسة الكفرون الرسمية المختلطة	1332	Akkar

School Location:	X	Y
	34.4564113	36.0741615

School Information:	Owned	Rented	No. of Blocks:	1
		✓		
	No. of Floors:	2	No. of Classrooms:	13

Director Name and Contact:	Khoder Ali Al Rifai	- Landline:	06-865167
		- Mobile:	70-501969

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
	✓			Type: SBS	Good

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Playground:	Yes	No	Comments	Condition	
	✓			Slab on grade	Good

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Tiles	Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
					✓
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
					✓
Shed:	Yes	No	Comments	Condition	
	✓		Red Brick	Good	To Repair
					✓
Rain Water System:	Yes	No	Comments	Condition	
	✓		PVC pipe	Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
		✓	Required	Good	To Repair
Source of Electricity:	EDL		Generator	Condition	
	✓		✓	Good	To Repair
				✓	

Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
55	El Kafroun Mixed Public School مدرسة الكفرون الرسمية المختلطة	1332	Akkar



School No.	School Name	CERD No.	Governorate / District
56	El Houweish Mixed Public School تكميلية الحويش الرسمية المختلطة	1334	Akkar

School Location:	X	Y
	34.4847044	36.1298872

School Information:	Owned	Rented	No. of Blocks:	1
		✓		
	No. of Floors:	3	No. of Classrooms:	14

Director Name and Contact:	Abed Azizi Rafiea	- Landline:	06-865112
		- Mobile:	71-650200

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
	✓		Type: PU	Good	To Repair ✓

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good ✓	To Repair

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Playground:	Yes	No	Comments	Condition	
	✓			Good ✓	To Repair

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Tiles	Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Internal Main Gate:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Source of Electricity:	EDL		Generator	Condition	
	✓		✓	Good	To Repair
				✓	




Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.


School No.	School Name	CERD No.	Governorate / District
56	El Houweish Mixed Public School تكميلية الحويش الرسمية المختلطة	1334	Akkar



School No.	School Name	CERD No.	Governorate / District
56	El Houweish Mixed Public School تكميلية الحويش الرسمية المختلطة	1334	Akkar

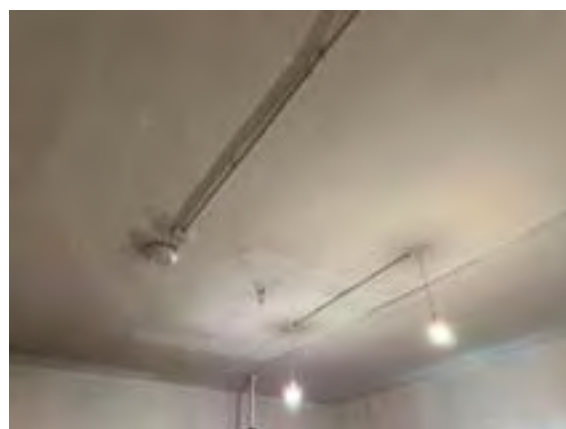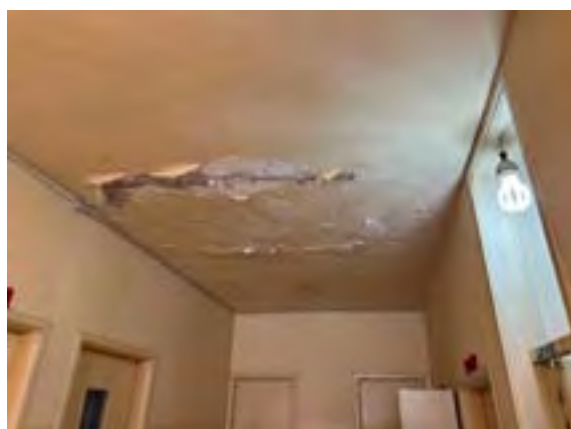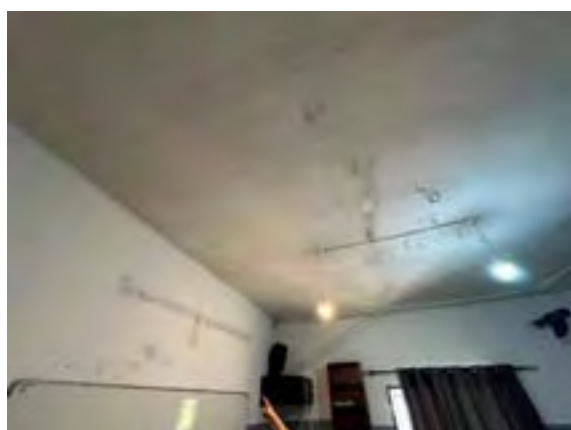

School No.	School Name	CERD No.	Governorate / District
56	El Houweish Mixed Public School تكميلية الحويش الرسمية المختلطة	1334	Akkar

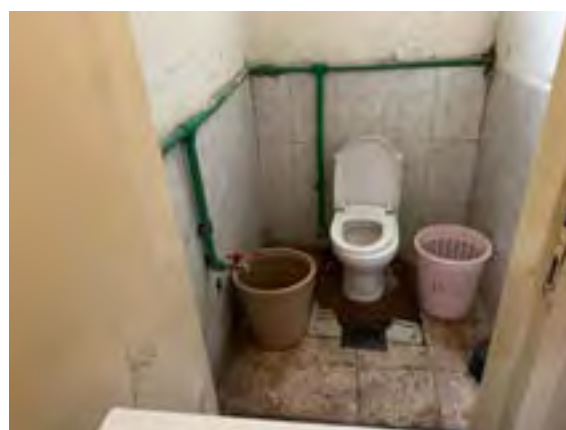

School No.	School Name	CERD No.	Governorate / District
57	Hrar Mixed Public School ثانوية حرار المختلطة الرسمية	1390	Akkar

School Location:

X	Y
34.4594533	36.123842

School Information:

Owned	Rented	No. of Blocks:	1
	✓		

No. of Floors:	3	No. of Classrooms:	15
----------------	---	--------------------	----

Director Name and Contact:

Walid Al Lakkis

- Landline:	06-865031
- Mobile:	03-988487

Building Condition: Category 1

Roof Heat Insulation:

Yes	No	Comments
	✓	

Condition	
Good	To Repair

Roof Waterproofing:

Yes	No	Comments
	✓	

Condition	
Good	To Repair

Presence of Parapet at Roof Floor:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Presence of Handicap Ramp at GF level:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Presence of Handicap Toilet:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Playground:

Yes	No	Comments
✓		Slab on grade

Condition	
Good	To Repair
✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Porcelain (taps to be changed)	Good	To Repair
					✓
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
					✓
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
					✓
Shed:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓		18 panels	Good	To Repair
				✓	
Source of Electricity:	EDL		Generator	Condition	
	✓			Good	To Repair
				✓	

Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.



School No.	School Name	CERD No.	Governorate / District
57	Hrar Mixed Public School ثانوية حرار المختلطة الرسمية	1390	Akkar



School No.	School Name	CERD No.	Governorate / District
57	Hrar Mixed Public School ثانوية حرار المختلطة الرسمية	1390	Akkar



School No.	School Name	CERD No.	Governorate / District
57	Hrar Mixed Public School ثانوية حرار المختلطة الرسمية	1390	Akkar

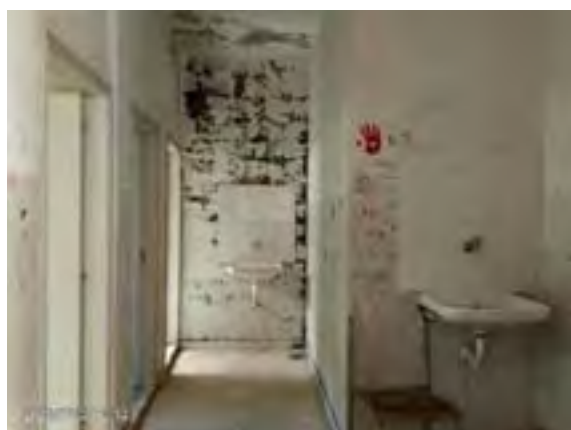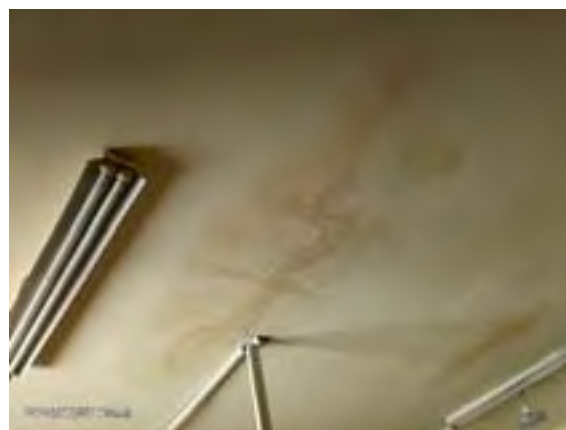

School No.	School Name	CERD No.	Governorate / District
64	EL Mouhammara Mixed Public School مدرسة المحمرة الرسمية المختلطة	1583	Akkar

School Location:	X	Y
	34.5077593	35.9690917

School Information:	Owned	Rented	No. of Blocks:	2
	✓ (Gift)			
	No. of Floors:	A:2,B:2	No. of Classrooms:	20

Director Name and Contact:	Bassam Mohamad Agha	- Landline:	06-876606
		- Mobile:	70-765628

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Roof Waterproofing:	Yes	No	Comments	Condition	
	✓			Good	To Repair ✓
Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair ✓
Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
	✓			Good	To Repair ✓
Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Playground:	Yes	No	Comments	Condition	
	✓			Type: concrete	Good

Drinking Fountain:	Yes	No	Comments	Condition	
		✓		Good	To Repair
External Main Gate:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Internal Main Gate:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓
Shed:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Source of Electricity:	EDL		Generator	Condition	
	No		✓	Good	To Repair
				✓	


Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
64	EL Mouhammara Mixed Public School مدرسة المحمرة الرسمية المختلطة	1583	Akkar



School No.	School Name	CERD No.	Governorate / District
64	EL Mouhammara Mixed Public School مدرسة المحمرة الرسمية المختلطة	1583	Akkar

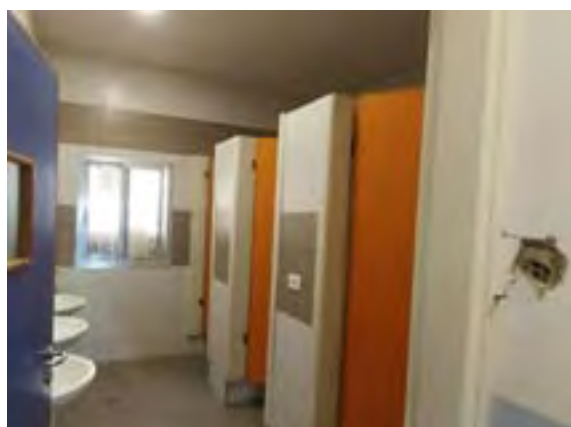

School No.	School Name	CERD No.	Governorate / District
67	Berqayel Public School ثانوية برقaille الرسمية للبنات	1612	Akkar

School Location:	X	Y
	34.4799734	36.0314467

School Information:	Owned	Rented	No. of Blocks:	1
		✓		
	No. of Floors:	2	No. of Classrooms:	20

Director Name and Contact:	Zahiya Mohamad Melhem	- Landline:	06-371030
		- Mobile:	70-395957

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
	✓		Type: SBS	Good	To Repair
				✓	

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Playground:	Yes	No	Comments	Condition	
	✓		S.O.G	Good	To Repair
				✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: tiles	Good ✓	To Repair
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: steel	Good	To Repair ✓
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: steel	Good	To Repair ✓
Shed:	Yes	No	Comments	Condition	
	✓		Type: steel + fiberglass	Good ✓	To Repair
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good ✓	To Repair
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good ✓	To Repair
Electrical System:	Yes	No	Comments	Condition	
	✓			Good ✓	To Repair
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good ✓	To Repair
Source of Electricity:	EDL		Generator	Condition	
	✓			Good ✓	To Repair



Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
67	Berqayel Public School ثانوية برقaille الرسمية للبنات	1612	Akkar



School No.	School Name	CERD No.	Governorate / District
67	Berqayel Public School ثانوية برقaille الرسمية للبنات	1612	Akkar

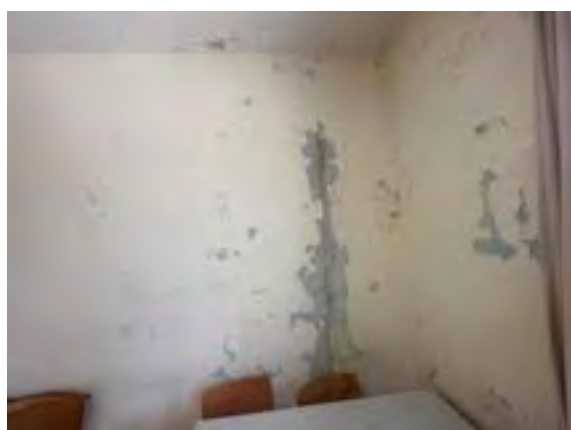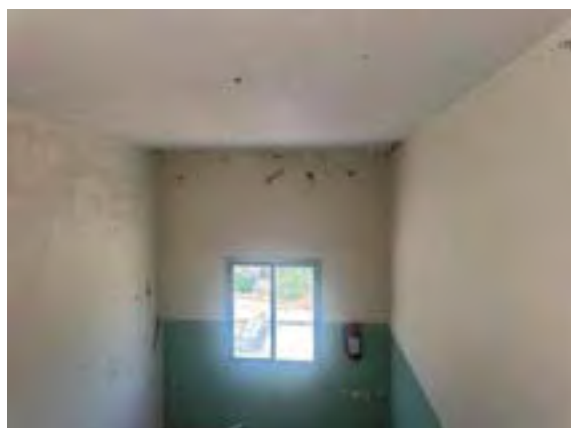

School No.	School Name	CERD No.	Governorate / District
71	Hilan Mixed Public School مدرسة حيلان الرسمية المختلطة	666	North / Zgharta

School Location:	X	Y
	34.4268669	35.9575715

School Information:	Owned	Rented	No. of Blocks:	1
	✓ (Gift)			
	No. of Floors:	4	No. of Classrooms:	12

Director Name and Contact:	Mohamad Khalil Abdel Aziz Chamma	- Landline:	70-709204
		- Mobile:	71-439994

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
	✓			Good	To Repair

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair


Playground:	Yes	No	Comments	Condition	
	✓		Slab on grade Stamped concrete	Good	To Repair
				✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Resin	Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓
Internal Main Gate:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
	✓		Red Bricks	Good	To Repair
				✓	
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓
Source of Electricity:	EDL		Generator	Condition	
	✓		✓	Good	To Repair

Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
71	Hilan Mixed Public School مدرسة حيلان الرسمية المختلطة	666	North / Zgharta

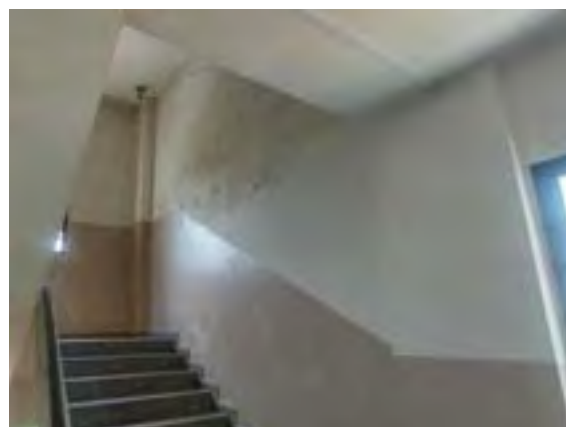

School No.	School Name	CERD No.	Governorate / District
72	El Fawar Mixed Public School مدرسة الفوار الرسمية المختلطة	669	North / Zgharta

School Location:	X	Y
	34.4320126	35.8855171

School Information:	Owned	Rented	No. of Blocks:	1
		✓		
	No. of Floors:	2	No. of Classrooms:	18

Director Name and Contact:	Sana Farouk Hoblos	- Landline:	06-685115
		- Mobile:	03-366838

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Roof Waterproofing:	Yes	No	Comments	Condition	
	✓		Type: SBS	Good	To Repair
				✓	
Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Playground:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Resin	Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
					✓
Internal Main Gate:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓
Shed:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Waste Water Drainage	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Source of Electricity:	EDL		Generator	Condition	
	✓			Good	To Repair
					✓


Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
72	El Fawar Mixed Public School مدرسة الفوار الرسمية المختلطة	669	North / Zgharta



School No.	School Name	CERD No.	Governorate / District
72	El Fawar Mixed Public School مدرسة الفوار الرسمية المختلطة	669	North / Zgharta

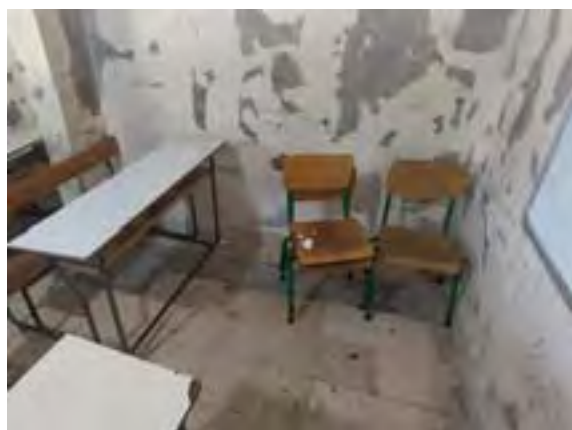

School No.	School Name	CERD No.	Governorate / District
74	El Airounieh Mixed Public School مدرسة العيرونية الرسمية المختلطة	682	North / Zgharta

School Location:	X	Y
	34.432881	35.876939

School Information:	Owned	Rented	No. of Blocks:	1
	✓ (Gift)			
	No. of Floors:	2	No. of Classrooms:	19

Director Name and Contact:	Abir Ali Ali	- Landline:	06-384029
		- Mobile:	76-066629

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Roof Waterproofing:	Yes	No	Comments	Condition	
				Good	To Repair
Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
				Good	To Repair
Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Playground:	Yes	No	Comments	Condition	
	✓			Good	To Repair

Drinking Fountain:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: steel	Good	To Repair
				✓	
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: steel	Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
	✓		Type: Resin	Good	To Repair
				✓	
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Source of Electricity:	EDL		Generator	Condition	
	✓		No	Good	To Repair
				✓	

Remarks:

The roof floor is the property of the mosque located on the upper floor. Leakage from the mosque's ablution area is affecting the ceiling of the school at the ground floor and requires remedial waterproofing and maintenance works. Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation and maintenance works that do not require structural intervention.

School No.	School Name	CERD No.	Governorate / District
74	El Airounieh Mixed Public School مدرسة العيرونية الرسمية المختلطة	682	North / Zgharta



School No.	School Name	CERD No.	Governorate / District
74	El Airounieh Mixed Public School مدرسة العيرونية الرسمية المختلطة	682	North / Zgharta



School No.	School Name	CERD No.	Governorate / District
75	Mareh Kfarsghab Mixed Public School مدرسة مرج كفارصغاب الرسمية المختلطة	687	North / Zgharta

School Location:	X	Y
	34.3405512	35.9049074

School Information:	Owned	Rented	No. of Blocks:	2
	✓ (Gift)			
	No. of Floors:	2	No. of Classrooms:	4

Director Name and Contact:	Christian Al Bacha	- Landline:	06-554816
		- Mobile:	03-853459

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
	✓		Type: SBS	Good	To Repair

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Playground:	Yes	No	Comments	Condition	
	✓		Slab on grade	Good	To Repair

Drinking Fountain:

Yes	No	Comments
✓		Type: Resin

Condition	
Good	To Repair
✓	

External Main Gate:

Yes	No	Comments
✓		Type: Steel

Condition	
Good	To Repair
✓	

Internal Main Gate:

Yes	No	Comments
✓		Type: Wood

Condition	
Good	To Repair
✓	

Shed:

Yes	No	Comments
✓		Type: steel covered with sandwich panel

Condition	
Good	To Repair
✓	

Rain Water System:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Waste Water Drainage System:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Electrical System:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

PV Solar Panel at Roof:

Yes	No	Comments
✓		4 panels

Condition	
Good	To Repair
✓	

Source of Electricity:

EDL	Generator
✓	

Condition	
Good	To Repair
Last level is a Mosque.	


Remarks:

The director reported low water pressure at the drinking fountain taps and at the water pressure valve of the water closet. Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation and maintenance works that do not require structural intervention.

School No.	School Name	CERD No.	Governorate / District
75	Mareh Kfarsghab Mixed Public School مدرسة مرج كفرضغاب الرسمية المختلطة	687	North / Zgharta



School No.	School Name	CERD No.	Governorate / District
75	Mareh Kfarsghab Mixed Public School مدرسة مرج كفرصغاب الرسمية المختلطة	687	North / Zgharta

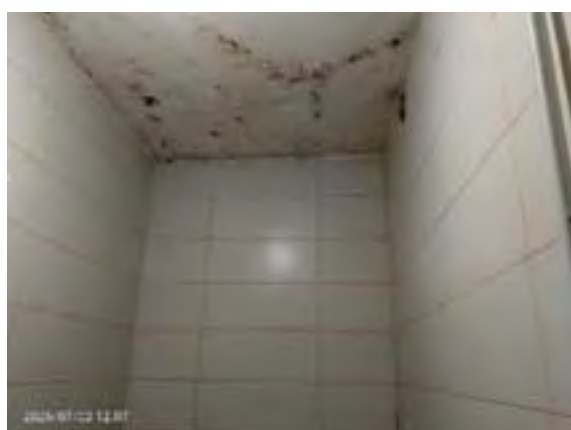

School No.	School Name	CERD No.	Governorate / District
77	Mezyara Mixed Public School مدرسة مزيارة الرسمية المختلطة	694	North / Zgharta

School Location:	X	Y
	34.336752	35.9269129

School Information:	Owned	Rented	No. of Blocks:	4
	✓			
	No. of Floors:	A,B,C,D:2	No. of Classrooms:	11

Director Name and Contact:	Daisy Youssef	- Landline:	06-570699
		- Mobile:	76-452083

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair


Playground:	Yes	No	Comments	Condition	
	✓		Slab on grade	Good	To Repair
					✓

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Tiles carara	Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: steel	Good	To Repair
				✓	
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: steel	Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Source of Electricity:	EDL		Generator	Condition	
	✓			Good	To Repair
				✓	

Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
77	Mezyara Mixed Public School مدرسة مزيارة الرسمية المختلطة	694	North / Zgharta

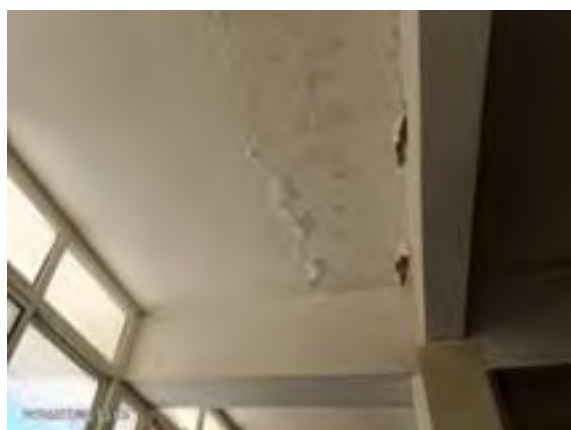

School No.	School Name	CERD No.	Governorate / District
77	Mezyara Mixed Public School مدرسة مزيارة الرسمية المختلطة	694	North / Zgharta



School No.	School Name	CERD No.	Governorate / District
78	Rashyin Mixed Public School ثانوية رشعين الرسمية المختلطة	1418	North / Zgharta

School Location:

X	Y
34.3940572	35.9183465

School Information:

Owned	Rented	No. of Blocks:	1
	✓		

No. of Floors:	3	No. of Classrooms:	11
----------------	---	--------------------	----

Director Name and Contact:

Reda Darjani

- Landline:	06-668100
- Mobile:	03-968875

Building Condition: Category 1

Roof Heat Insulation:

Yes	No	Comments
	✓	

Condition	
Good	To Repair

Roof Waterproofing:

Yes	No	Comments
	✓	

Condition	
Good	To Repair

Presence of Parapet at Roof Floor:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Presence of Handicap Ramp at GF level:

Yes	No	Comments
	✓	

Condition	
Good	To Repair

Presence of Handicap Toilet:

Yes	No	Comments
	✓	

Condition	
Good	To Repair

Playground:

Yes	No	Comments
✓		Slab on grade

Condition	
Good	To Repair
	✓

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Tiles	Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Internal Main Gate:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Source of Electricity:	EDL		Generator	Condition	
	No		No	Good	To Repair

Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
78	Rashyin Mixed Public School ثانوية رشعين الرسمية المختلطة	1418	North / Zgharta



School No.	School Name	CERD No.	Governorate / District
78	Rashyin Mixed Public School ثانوية رشعين الرسمية المختلطة	1418	North / Zgharta

