

**REPUBLIC OF LEBANON
COUNCIL FOR DEVELOPMENT & RECONSTRUCTION**



**Lebanon Emergency Assistance Project
(LEAP)**

**Rehabilitation of Schools–Shelters
“LEAP-SH-SW-MEHE- Batch 1 (Lot 3)”**

**Assessment Report - Activity A2
Schools Findings, Location Maps &
Photographs**

Prepared By:

Ref. L2026-06
August, 2026

Lebanon Emergency Assistance Project (LEAP)

Tender Preparation and Construction Supervision For the Rehabilitation of Schools–Shelters

Assessment Report - Activity A2

Schools Findings, Location Maps & Photographs

School Site Assessment Findings and Documentation

Following the completion of the site assessment of all assigned schools, the findings and observations for each school are presented in the following sections. The purpose of this documentation is to provide a clear and comprehensive overview of the existing physical, structural, functional, and general condition of each school based on the site visits and visual assessments carried out by the assessment team.

For each assessed school, the information is organized systematically to facilitate identification of the school, understanding of its location and general characteristics, and evaluation of its current condition. The documentation for each school includes the school assessment sheet, location map, and photographic documentation.

The location map, obtained through Google Maps, provides a visual reference to the school's geographical position, while the photographs document the existing conditions observed during the site assessment and provide visual evidence supporting the findings recorded in the assessment sheet.

The assessment sheets are arranged according to the school serial number, allowing each school to be easily identified and cross-referenced with its corresponding maps and photographs. The following information is provided for each school:

1. School Identification and Location Information

The assessment starts with the basic identification details of the school, including:

- School serial number;
- School name;
- CERD number;
- Governorate and district;
- School location and geographical coordinates, including the X and Y coordinates.

The coordinates are provided to accurately identify the school's geographical location and facilitate its reference on the corresponding location map.

2. General School and Building Information

General information regarding the school premises and its physical configuration is then provided. This includes the ownership status of the property, indicating whether the school building is owned or rented, as well as the number of building blocks, number of floors, and number of classrooms within the premises.

This information is important for understanding the overall size and configuration of the school and for establishing the context in which the technical condition of the buildings and facilities has been assessed.

3. School Administration and Contact Information

The name of the school director or responsible administrator is recorded together with the available telephone number or other contact details. This information provides a reference for communication and, where necessary, for clarification of specific observations or issues identified during the assessment.

4. Technical Assessment of the Existing Condition

A detailed description of the technical condition of the school is provided based on the visual assessment undertaken during the site visit. The assessment considers the observable condition of the main building components and facilities, as applicable, including the general condition of the buildings, structural elements, roofs, walls, floors, doors and windows, electrical and plumbing installations, sanitary facilities, water supply and drainage systems, and other relevant school infrastructure.

The assessment is primarily based on visual inspection and observations made during the site visit. It is intended to document visible defects, deterioration, deficiencies, damage, maintenance requirements, and other conditions that may affect the functionality, safety, usability, or overall condition of the school facilities. Where relevant, the findings are supported by photographs included in the school documentation.

5. Special Remarks and Observations

At the end of each assessment sheet, special remarks and observations are provided to record specific conditions or issues that require particular attention. These remarks may include unusual site conditions, significant defects, accessibility concerns, urgent maintenance requirements, restrictions encountered during the assessment, or other observations that may not be fully reflected in the standard assessment categories.

School List

The following table presents the list of schools, including the serial number, school name, CERD number, and governorate/district location.

LEAP-SH-SW-MEHE- Batch 1
Lot 3 – Akkar Governorate (23 Schools)

School No.	School Name	CERD No.	Governorate / District
3	Al Sheikh Ayyash Mixed Public School مدرسة الشيخ عياش الرسمية المختلطة	513	Akkar
4	Sheirhmarin Mixed Public School شير حميرين الرسمية المختلطة عكار	514	Akkar
8	Al Shiekh Zannad Public School الشيخ زناد	520	Akkar
9	El Kneysa Mixed Public School مدرسة الكنيسة الرسمية المختلطة	522	Akkar
10	El Simmakiah Mixed Public School مدرسة السماقية الرسمية المختلطة	524	Akkar
11	Sulaiman Aly - hekr el daher Public School مدرسة المربي سليمان عزيز العلي الرسمية حكر الضاهري	525	Akkar
29	EL Kawashra Mixed Public School مدرسة الكواشرة الرسمية المختلطة	577	Akkar
30	Ammar El Bikat Mixed Public School مدرسة عمار البيكات الرسمية المختلطة	579	Akkar
31	Kashlak Public School مدرسة قشلق الرسمية	580	Akkar
32	Ain El Zeit Mixed Public School مدرسة عين الزيت الرسمية المختلطة	587	Akkar
33	El Bireh Secondary Public School ثانوية البيرة الرسمية	590	Akkar
50	El Sindyaneh Mixed Public School مدرسة السنديانة الرسمية المختلطة	640	Akkar
51	Mouzeid Dendashle - Mashta Hammoud مدرسة المربي مزيد الدندشلي مشتي حمود الرسمية	650	Akkar
52	Qarha Mixed Public School مدرسة قرحة الرسمية المختلطة	654	Akkar
53	Rafik Hariri - Rajem Issa Public School مدرسة رفيق الحريري الرسمية المختلطة - رجم حسين	656	Akkar
54	El Heishe Secondary - Wadi Khaled School ثانوية الهيشة الرسمية - وادي خالد	663	Akkar
58	Tel Hmeira Mixed Public School مدرسة تل حميرة المتوسطة الرسمية	1409	Akkar
59	El Amayer Public School مدرسة العماير الرسمية	1459	Akkar
61	Kfartoun Public School ثانوية كفرتون الرسمية	1490	Akkar
62	El Awadeh Public School مدرسة العوادة الرسمية	1550	Akkar
63	El Bkayieh Mixed Public School مدرسة البقعة الرسمية المختلطة	1553	Akkar
70	Sandiyanit Zeidan Public School ثانوية سنديانة زيدان الرسمية	1637	Akkar
79	El Bireh Elementary Public School تكميلية البيرة الرسمية	589	Akkar

School No.	School Name	CERD No.	Governorate / District
3	Al Sheikh Ayyash Mixed Public School مدرسة الشيخ عياش الرسمية المختلطة	513	Akkar

School Location:	X	Y
	34.6275845	36.0909265

School Information:	Owned	Rented	No. of Blocks:	2
		✓		
	No. of Floors:	A:2,B:1	No. of Classrooms:	26

Director Name and Contact:	Ali Khodor Alwan	- Landline:	06-815235
		- Mobile:	70-291250

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
	✓		Type: SBS	Good	To Repair ✓

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good ✓	To Repair

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
	✓		- Block 2 - Kindergartens	Good ✓	To Repair

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓	Possibility to add accessible	Good	To Repair

Playground:	Yes	No	Comments	Condition	
	✓		Type: Concrete	Good ✓	To Repair

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Tiles - Resin	Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
	✓		Type: Sandwish Panel	Good	To Repair
				✓	
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Source of Electricity:	EDL		Generator	Condition	
	✓		✓	Good	To Repair
				✓	

Remarks:

The school did not accommodate displaced persons.

Based on the visual assessment, the required interventions are limited to minor rehabilitation works, including the provision of a ramp to facilitate the installation of a restroom at the playground below the kindergarten section and localized improvement of the tiling around the existing drinking water taps.

Accordingly, the school is classified as **Category 1**, with no structural intervention required.

School No.	School Name	CERD No.	Governorate / District
3	Al Sheikh Ayyash Mixed Public School مدرسة الشيخ عياش الرسمية المختلطة	513	Akkar



School No.	School Name	CERD No.	Governorate / District
3	Al Sheikh Ayyash Mixed Public School مدرسة الشيخ عياش الرسمية المختلطة	513	Akkar



School No.	School Name	CERD No.	Governorate / District
3	Al Sheikh Ayyash Mixed Public School مدرسة الشيخ عياش الرسمية المختلطة	513	Akkar



School No.	School Name	CERD No.	Governorate / District
4	Sheirhmarin Mixed Public School شير حميرين الرسمية المختلطة عكار	514	Akkar

School Location:	X	Y
	34.6200783	36.117641

School Information:	Owned	Rented	No. of Blocks:	2
	✓ (Gift)			
	No. of Floors:	A:3,B:1	No. of Classrooms:	22

Director Name and Contact:	Massoud Nehman Al Alman	- Landline:	06-815263
		- Mobile:	03-470003

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Playground:	Yes	No	Comments	Condition	
	✓		Type: Pavement tiles	Good	To Repair
				✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Resin	Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: steel	Good	To Repair
				✓	
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: steel	Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
	✓		Type: Sandwish panel	Good	To Repair
				✓	
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Source of Electricity:	EDL		Generator	Condition	
			✓	Good	To Repair
				✓	

Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
4	Sheirhmarin Mixed Public School شير حميرين الرسمية المختلطة عكار	514	Akkar



School No.	School Name	CERD No.	Governorate / District
4	Sheirhmarin Mixed Public School شير حميرين الرسمية المختلطة عكار	514	Akkar



School No.	School Name	CERD No.	Governorate / District
8	Al Shiekh Zannad Public School الشيخ زناد	520	Akkar

School Location:	X	Y
	34.60778	35.98891

School Information:	Owned	Rented	No. of Blocks:	2
	✓			
	No. of Floors:	A2:,B:1	No. of Classrooms:	14

Director Name and Contact:	Mounzir Abou Ali	- Landline:	06-820115
		- Mobile:	76-674511

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Playground:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Tiles - Resin	Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
	✓		Type: Sandwish – Zinc	Good	To Repair
				✓	
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Source of Electricity:	EDL		Generator	Condition	
	✓		✓	Good	To Repair
					Generator

Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
8	Al Shiekh Zannad Public School الشيخ زناد	520	Akkar



School No.	School Name	CERD No.	Governorate / District
8	Al Shiekh Zannad Public School الشيخ زناد	520	Akkar



School No.	School Name	CERD No.	Governorate / District
9	El Kneysa Mixed Public School مدرسة الكنيسة الرسمية المختلطة	522	Akkar

School Location:	X	Y
	34.618945	36.0205716

School Information:	Owned	Rented	No. of Blocks:	1
	✓ (Gift)			
	No. of Floors:	2	No. of Classrooms:	13

Director Name and Contact:	Nasser Chammou	- Landline:	06-820280
		- Mobile:	81-041310

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
	✓			Type: SBS	Good

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Playground:	Yes	No	Comments	Condition	
	✓			Type: Concrete	Good

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Need 5 taps	Good	To Repair
					✓
External Main Gate:	Yes	No	Comments	Condition	
	✓		- Type: Steel	Good	To Repair
					✓
Internal Main Gate:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓
Shed:	Yes	No	Comments	Condition	
	✓		- Type: Zinc plastic type - Water leakage from the edges	Good	To Repair
					✓
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Source of Electricity:	EDL		Generator	Condition	
	✓		✓	Good	To Repair
				✓	

Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
9	El Kneysa Mixed Public School مدرسة الكنيسة الرسمية المختلطة	522	Akkar



School No.	School Name	CERD No.	Governorate / District
9	El Kneysa Mixed Public School مدرسة الكنيسة الرسمية المختلطة	522	Akkar



School No.	School Name	CERD No.	Governorate / District
10	El Simmakiah Mixed Public School مدرسة السماقية الرسمية المختلطة	524	Akkar

School Location:	X	Y
	34.6386163	36.0016697

School Information:	Owned	Rented	No. of Blocks:	2
	✓ (Gift)			
	No. of Floors:	A:2,B:2	No. of Classrooms:	14

Director Name and Contact:	Samar Said	- Landline:	06-820135
		- Mobile:	81-335119

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
	✓		Type: SBS	Good	To Repair
				✓	

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
	✓			Good	To Repair

Playground:	Yes	No	Comments	Condition	
	✓		Type: Concrete	Good	To Repair
				✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Resin (out of service)	Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
	✓		Type: Zinc – Brick	Good	To Repair
				✓	
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓		Needs configuration	Good	To Repair
					✓
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Source of Electricity:	EDL		Generator	Condition	
	✓		✓	Good	To Repair
				✓	

Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
10	El Simmakiah Mixed Public School مدرسة السماقية الرسمية المختلطة	524	Akkar



School No.	School Name	CERD No.	Governorate / District
10	El Simmakiah Mixed Public School مدرسة السماقية الرسمية المختلطة	524	Akkar



School No.	School Name	CERD No.	Governorate / District
11	Sulaiman Aziz Al Aly - hekr el daher Public School مدرسة المربي سليمان عزيز العلي الرسمية حكر الظاهري	525	Akkar

School Location:	X	Y
	34.6326809	36.0208193

School Information:	Owned	Rented	No. of Blocks:	1
	✓ (Gift)			

No. of Floors:	2	No. of Classrooms:	9
----------------	---	--------------------	---

Director Name and Contact:	Rola Shamaa	- Landline:	06-820200
		- Mobile:	79-197399

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
	✓		Type: SBS	Good	To Repair
					✓

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Playground:	Yes	No	Comments	Condition	
	✓		Type: Concrete	Good	To Repair
				✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Tiles	Good ✓	To Repair
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good ✓	To Repair
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good ✓	To Repair
Shed:	Yes	No	Comments	Condition	
	✓		Type: Asbestos & Sandwich panel	Good	To Repair ✓
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good ✓	To Repair
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good ✓	To Repair
Electrical System:	Yes	No	Comments	Condition	
	✓		Needs configuration	Good	To Repair ✓
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good	To Repair ✓
Source of Electricity:	EDL		Generator	Condition	
	✓		✓ Out of service	Good	To Repair ✓

Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
11	Sulaiman Aly - hekr el daher Public School مدرسة المربي سليمان عزيز العلي الرسمية حكر الظاهري	525	Akkar



School No.	School Name	CERD No.	Governorate / District
11	Sulaiman Aly - hekr el daher Public School مدرسة المربي سليمان عزيز العلي الرسمية حكر الظاهري	525	Akkar



School No.	School Name	CERD No.	Governorate / District
29	EL Kawashra Mixed Public School مدرسة الكواشرا الرسمية المختلطة	577	Akkar

School Location:	X	Y
	34.6113891	36.2118975

School Information:	Owned	Rented	No. of Blocks:	1
	✓			
	No. of Floors:	3	No. of Classrooms:	26

Director Name and Contact:	Majed Saeed Mohamad	- Landline:	06-830251
		- Mobile:	70-370305

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Playground:	Yes	No	Comments	Condition	
	✓		Type: Concrete	Good	To Repair
				✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Tiles	Good ✓	To Repair
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair ✓
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good ✓	To Repair
Shed:	Yes	No	Comments	Condition	
	✓		Type: Sandwish panel - Resin	Good	To Repair ✓
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good ✓	To Repair
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good ✓	To Repair
Electrical System:	Yes	No	Comments	Condition	
	✓			Good ✓	To Repair
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good ✓	To Repair
Source of Electricity:	EDL		Generator	Condition	
	✓		✓	Good ✓	To Repair

Remarks:

Based on the visual site assessment, the school is classified as Category 1, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

The School Needs waterproofing due to cracks.

School No.	School Name	CERD No.	Governorate / District
29	EL Kawashra Mixed Public School مدرسة الكواشرا الرسمية المختلطة	577	Akkar



School No.	School Name	CERD No.	Governorate / District
29	EL Kawashra Mixed Public School مدرسة الكواشرا الرسمية المختلطة	577	Akkar



School No.	School Name	CERD No.	Governorate / District
29	EL Kawashra Mixed Public School مدرسة الكواشرا الرسمية المختلطة	577	Akkar



School No.	School Name	CERD No.	Governorate / District
30	Ammar El Bikat Mixed Public School مدرسة عمار البيكات الرسمية المختلطة	579	Akkar

School Location:	X	Y
	34.6093483	36.1639641

School Information:	Owned	Rented	No. of Blocks:	1
	✓			
	No. of Floors:	2	No. of Classrooms:	10

Director Name and Contact:	Diana Fouad Kafrouni	- Landline:	06-845941
		- Mobile:	70-036131

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Roof Waterproofing:	Yes	No	Comments	Condition	
		✓		Good	To Repair
					✓
Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Presence of Handicap Toilet:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Playground:	Yes	No	Comments	Condition	
	✓		Type: Concrete	Good	To Repair
				✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Taps to be replaced	Good	To Repair ✓
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good ✓	To Repair
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good ✓	To Repair
Shed:	Yes	No	Comments	Condition	
	✓		Type: Plastic	Good	To Repair ✓
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good ✓	To Repair
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good ✓	To Repair
Electrical System:	Yes	No	Comments	Condition	
	✓			Good ✓	To Repair
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good ✓	To Repair
Source of Electricity:	EDL		Generator	Condition	
	✓		No	Good ✓	To Repair


Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
30	Ammar El Bikat Mixed Public School مدرسة عمار البيكات الرسمية المختلطة	579	Akkar



School No.	School Name	CERD No.	Governorate / District
30	Ammar El Bikat Mixed Public School مدرسة عمار البيكات الرسمية المختلطة	579	Akkar

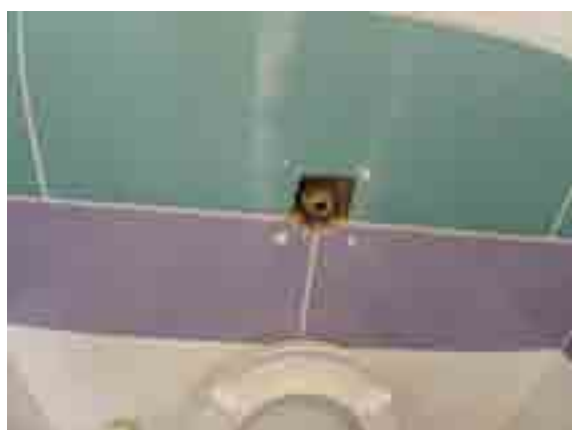

School No.	School Name	CERD No.	Governorate / District
31	Kashlak Public School مدرسة قشلاق الرسمية	580	Akkar

School Location:	X	Y
	34.6132455	36.1578654

School Information:	Owned	Rented	No. of Blocks:	1
	✓			
	No. of Floors:	1	No. of Classrooms:	12

Director Name and Contact:	Chadia Saadallah Sakr	- Landline:	06-845582
		- Mobile:	70-543939

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
	✓		Type: SBS	Good	To Repair
				✓	

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Playground:	Yes	No	Comments	Condition	
	✓		Type: concrete	Good	To Repair
				✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Tiles Not used	Good	To Repair
External Main Gate:	Yes	No	Comments	Condition	
	✓			Good	To Repair
Internal Main Gate:	Yes	No	Comments	Condition	
	✓			Good	To Repair
Shed:	Yes	No	Comments	Condition	
	✓		Type: Zinc - plastic	Good	To Repair
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
Electrical System:	Yes	No	Comments	Condition	
	✓		Panel board configuration	Good	To Repair
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good	To Repair
Source of Electricity:	EDL		Generator	Condition	
	No		No	Good	To Repair

Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
31	Kashlak Public School مدرسة قشلق الرسمية	580	Akkar



School No.	School Name	CERD No.	Governorate / District
31	Kashlak Public School مدرسة قشلق الرسمية	580	Akkar



School No.	School Name	CERD No.	Governorate / District
32	Ain El Zeit Mixed Public School مدرسة عين الزيت الرسمية المختلطة	587	Akkar

School Location:	X	Y
	34.5899868	36.2010442

School Information:	Owned	Rented	No. of Blocks:	1
	✓			
	No. of Floors:	2	No. of Classrooms:	11

Director Name and Contact:	Samara Mostapha Abu Daher	- Landline:	06-836055
		- Mobile:	71-856482

Building Condition: Category 1

Roof Heat Insulation:	Yes	No	Comments	Condition	
	✓			Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Playground:	Yes	No	Comments	Condition	
	✓		Type: concrete	Good	To Repair

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Tiles - Resin	Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
					✓
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
	✓		Type: Sandwish panel	Good	To Repair
				✓	
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Source of Electricity:	EDL		Generator	Condition	
	✓			Good	To Repair
				✓	

Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
32	Ain El Zeit Mixed Public School مدرسة عين الزيت الرسمية المختلطة	587	Akkar



School No.	School Name	CERD No.	Governorate / District
32	Ain El Zeit Mixed Public School مدرسة عين الزيت الرسمية المختلطة	587	Akkar



School No.	School Name	CERD No.	Governorate / District
32	Ain El Zeit Mixed Public School مدرسة عين الزيت الرسمية المختلطة	587	Akkar



School No.	School Name	CERD No.	Governorate / District
33	El Bireh Secondary Public School ثانوية البيرة الرسمية	590	Akkar

School Location:	X	Y
	34.5869998	36.2332421

School Information:	Owned	Rented	No. of Blocks:	1
	✓			
	No. of Floors:	3	No. of Classrooms:	15

Director Name and Contact:	Yassine Al Rashid Hassan Al Moraabi	- Landline:	06-830801
		- Mobile:	03-854704

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Roof Waterproofing:	Yes	No	Comments	Condition	
	✓			Good	To Repair
			Type: SBS	✓	
Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Presence of Handicap Toilet:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Playground:	Yes	No	Comments	Condition	
	✓			Good	To Repair
			Type: concrete	✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Resin	Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓		Panel board configuration	Good	To Repair
					✓
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Source of Electricity:	EDL		Generator	Condition	
	✓		✓	Good	To Repair
				✓	


Remarks:

The school is part of a larger building that also accommodates Intermediate Schools No. 589. Although the schools are separately allocated within the building by the Ministry, the identified requirements are limited to minor rehabilitation works and do not require structural intervention. Accordingly, the school is classified as **Category 1**.

School No.	School Name	CERD No.	Governorate / District
33	El Bireh Secondary Public School ثانوية البيرة الرسمية	590	Akkar



School No.	School Name	CERD No.	Governorate / District
33	El Bireh Secondary Public School ثانوية البيرة الرسمية	590	Akkar

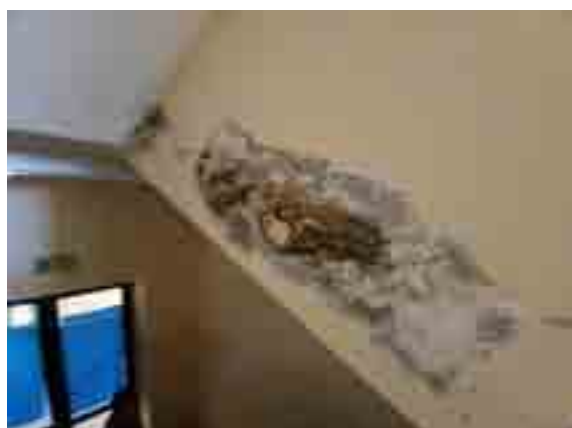

School No.	School Name	CERD No.	Governorate / District
50	El Sindyaneh Mixed Public School مدرسة السنديانة الرسمية المختلطة	640	Akkar

School Location:	X	Y
	34.5815071	36.2444232

School Information:	Owned	Rented	No. of Blocks:	1
	✓			
	No. of Floors:	4	No. of Classrooms:	17

Director Name and Contact:	Rania Ajaj Ibrahim	- Landline:	06-830522
		- Mobile:	70-371573

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Roof Waterproofing:	Yes	No	Comments	Condition	
	✓			Good	To Repair
			Type: PU	✓	
Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Playground:	Yes	No	Comments	Condition	
	✓			Good	To Repair
			Type: Concrete	✓	


Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Tiles	Good	To Repair
External Main Gate:	Yes	No	Comments	Condition	
	✓		Need taps	Good	To Repair
Internal Main Gate:	Yes	No	Comments	Condition	
	✓			Good	To Repair
Shed:	Yes	No	Comments	Condition	
				Good	To Repair
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good	To Repair
Source of Electricity:	EDL		Generator	Condition	
	✓		✓	Good	To Repair

Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

El Sindyaneh School (CERD 640) is located in the same building as School (CERD 1673), which is also included under this project under Serial No. 70. The two schools are separated from each other by a steel door..

School No.	School Name	CERD No.	Governorate / District
50	El Sindyaneh Mixed Public School مدرسة السنديانة الرسمية المختلطة	640	Akkar

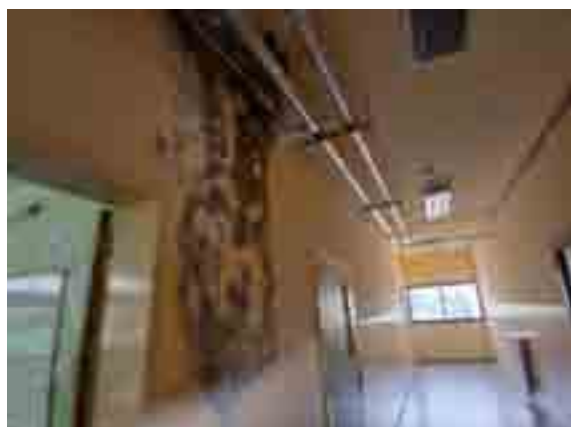

School No.	School Name	CERD No.	Governorate / District
50	El Sindyaneh Mixed Public School مدرسة السنديانة الرسمية المختلطة	640	Akkar



School No.	School Name	CERD No.	Governorate / District
51	Mouzeid Dendashle - Mashta Hammoud مدرسة المربي مزيد الدندشلي مشتي حمود الرسمية	650	Akkar

School Location:

X	Y
34.6297135	36.3263215

School Information:

Owned	Rented	No. of Blocks:	2
✓ (Gift)			
No. of Floors:	A:3,B:2	No. of Classrooms:	19

Director Name and Contact:

Mahmoud Ahmad Ajam

- Landline:

06-860173

- Mobile:

70-579197

Building Condition:

Category 1

Roof Heat Insulation:

Yes	No	Comments
	✓	

Condition	
Good	To Repair

Roof Waterproofing:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Presence of Parapet at Roof Floor:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Presence of Handicap Ramp at GF level:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Presence of Handicap Toilet:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Playground:

Yes	No	Comments
✓		Type: concrete

Condition	
Good	To Repair
✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Tiles (need taps)	Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
	✓		Type: Plastic (Resin) – Zinc - Brick	Good	To Repair
					✓
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Source of Electricity:	EDL		Generator	Condition	
	✓		No	Good	To Repair
				✓	

Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
51	Mouzeid Dendashle - Mashta Hammoud مدرسة المربي مزيد الدندشلي مشتي حمود الرسمية	650	Akkar



School No.	School Name	CERD No.	Governorate / District
51	Mouzeid Dendashle - Mashta Hammoud مدرسة المربي مزيد الدندشلي مشتي حمود الرسمية	650	Akkar



School No.	School Name	CERD No.	Governorate / District
52	Qarha Mixed Public School مدرسة قرحة الرسمية المختلطة	654	Akkar

School Location:	X	Y
	34.6210546	36.4427419

School Information:	Owned	Rented	No. of Blocks:	2
	✓ (Gift)			
	No. of Floors:	A:1,B:1	No. of Classrooms:	12

Director Name and Contact:	Yasser Ali Obeid	- Landline:	
		- Mobile:	71-413392

Building Condition: Category 1

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
	✓		Type: SBS	Good	To Repair
				✓	

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Playground:	Yes	No	Comments	Condition	
	✓		Concrete	Good	To Repair
				✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Tiles	Good	To Repair
					✓
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
					✓
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
					✓
Shed:	Yes	No	Comments	Condition	
	✓		Type: Zinc	Good	To Repair
					✓
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓		23 panels	Good	To Repair
				✓	
Source of Electricity:	EDL		Generator	Condition	
	✓			Good	To Repair
				✓	

Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
52	Qarha Mixed Public School مدرسة قرحة الرسمية المختلطة	654	Akkar



School No.	School Name	CERD No.	Governorate / District
52	Qarha Mixed Public School مدرسة قرحة الرسمية المختلطة	654	Akkar



School No.	School Name	CERD No.	Governorate / District
53	Rafik Hariri - Rajem Issa Public School مدرسة رفيق الحريري الرسمية المختلطة - رجم حسين	656	Akkar

School Location:	X	Y
	34.6067581	36.3850317

School Information:	Owned	Rented	No. of Blocks:	2
	✓ (Gift)			
	No. of Floors:	A:3-B:1	No. of Classrooms:	25

Director Name and Contact:	Assad El Hasan	- Landline:	06-870131
		- Mobile:	03-717353

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Playground:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Resin	Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
	✓		Type: Zinc - Brick	Good	To Repair
					✓
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Source of Electricity:	EDL		Generator	Condition	
	✓			Good	To Repair
				✓	

Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
53	Rafik Hariri - Rajem Issa Public School مدرسة رفيق الحريري الرسمية المختلطة - رجم حسين	656	Akkar



School No.	School Name	CERD No.	Governorate / District
53	Rafik Hariri - Rajem Issa Public School مدرسة رفيق الحريري الرسمية المختلطة - رجم حسين	656	Akkar



School No.	School Name	CERD No.	Governorate / District
53	Rafik Hariri - Rajem Issa Public School مدرسة رفيق الحريري الرسمية المختلطة - رجم حسين	656	Akkar



School No.	School Name	CERD No.	Governorate / District
54	El Heishe Secondary - Wadi Khaled School ثانوية الهيشة الرسمية وادي خالد	663	Akkar

School Location:	X	Y
	34.6383385	36.3665992

School Information:	Owned	Rented	No. of Blocks:	2
		✓		
	No. of Floors:	A:2,B:1	No. of Classrooms:	11

Director Name and Contact:	Fayek Chehade	- Landline:	06-870051
		- Mobile:	70-654618

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
	✓		Type: SBS	Good	To Repair
					✓

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Playground:	Yes	No	Comments	Condition	
	✓		Concrete	Good	To Repair
				✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Tiles (need taps)	Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
	✓		Type: Zinc	Good	To Repair
				✓	
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Source of Electricity:	EDL		Generator	Condition	
	✓		✓	Good	To Repair
				✓	


Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
54	El Heishe Secondary - Wadi Khaled School ثانوية الهيشة الرسمية - وادي خالد	663	Akkar



School No.	School Name	CERD No.	Governorate / District
54	El Heishe Secondary - Wadi Khaled School ثانوية الهيشة الرسمية وادي خالد	663	Akkar

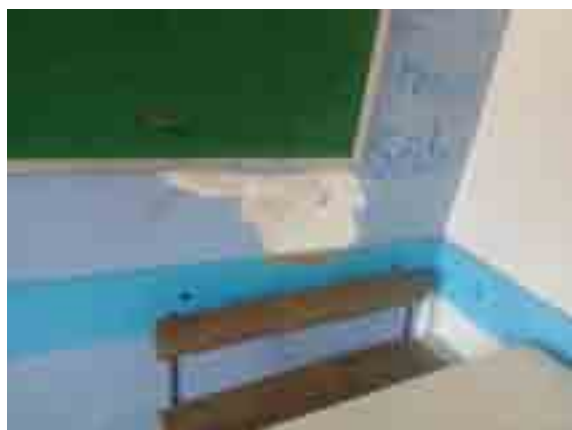

School No.	School Name	CERD No.	Governorate / District
58	Tel Hmeira Mixed Public School مدرسة تل حميرة المتوسطة الرسمية	1409	Akkar

School Location:

X	Y
34.6259899	36.0779951

School Information:

Owned	Rented	No. of Blocks:	1
	✓		

No. of Floors:	3	No. of Classrooms:	20
----------------	---	--------------------	----

Director Name and Contact:

Hussein Ahmad Chahhoud	- Landline:	06-810013
	- Mobile:	03-374271

Building Condition: Category 1

Roof Heat Insulation:

Yes	No	Comments
	✓	

Condition	
Good	To Repair

Roof Waterproofing:

Yes	No	Comments
	✓	

Condition	
Good	To Repair

Presence of Parapet at Roof Floor:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Presence of Handicap Ramp at GF level:

Yes	No	Comments
✓		

Condition	
Good	To Repair
✓	

Presence of Handicap Toilet:

Yes	No	Comments
	✓	

Condition	
Good	To Repair

Playground:

Yes	No	Comments
✓		Type: Concrete

Condition	
Good	To Repair
✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Tiles – Resin	Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
	✓		Type: Sandwish panel – Zinc – Plastic	Good	To Repair
				✓	
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Source of Electricity:	EDL		Generator	Condition	
	✓			Good	To Repair
				✓	

Remarks:

There is potential to convert a standard toilet into an accessible (handicap) toilet and construct an access ramp. The staircase tiles are in good condition, with no damage observed. The kindergarten section was previously renovated by MEHE; however, the restrooms require some maintenance. Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation and maintenance works that do not require structural intervention.

School No.	School Name	CERD No.	Governorate / District
58	Tel Hmeira Mixed Public School مدرسة تل حميرة المتوسطة الرسمية	1409	Akkar



School No.	School Name	CERD No.	Governorate / District
58	Tel Hmeira Mixed Public School مدرسة تل حميرة المتوسطة الرسمية	1409	Akkar



School No.	School Name	CERD No.	Governorate / District
58	Tel Hmeira Mixed Public School مدرسة تل حميرة المتوسطة الرسمية	1409	Akkar



School No.	School Name	CERD No.	Governorate / District
59	El Amayer Public School مدرسة العمائر الرسمية	1459	Akkar

School Location:	X	Y
	34.628618	36.3830475

School Information:	Owned	Rented	No. of Blocks:	2
		✓		
	No. of Floors:	2-3	No. of Classrooms:	17

Director Name and Contact:	Mohamad El Daas	- Landline:	06-391123
		- Mobile:	03-497868

Building Condition: Category 1

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
	✓		Type: SBS	Good	To Repair
				✓	

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Playground:	Yes	No	Comments	Condition	
	✓		Type: Concrete	Good	To Repair
				✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Tiles	Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
	✓		Type: Zinc	Good	To Repair
				✓	
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Source of Electricity:	EDL		Generator	Condition	
	✓		✓	Good	To Repair
				✓	

Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.




School No.	School Name	CERD No.	Governorate / District
59	El Amayer Public School مدرسة العمائر الرسمية	1459	Akkar



School No.	School Name	CERD No.	Governorate / District
59	El Amayer Public School مدرسة العمائر الرسمية	1459	Akkar



School No.	School Name	CERD No.	Governorate / District
59	El Amayer Public School مدرسة العمائر الرسمية	1459	Akkar

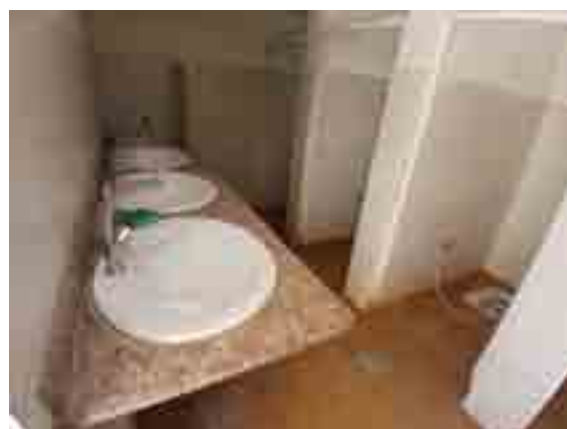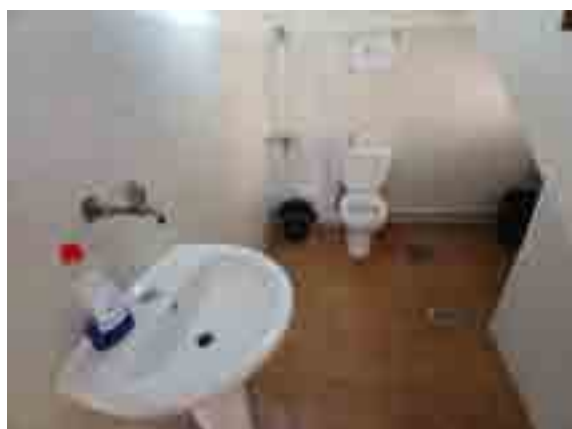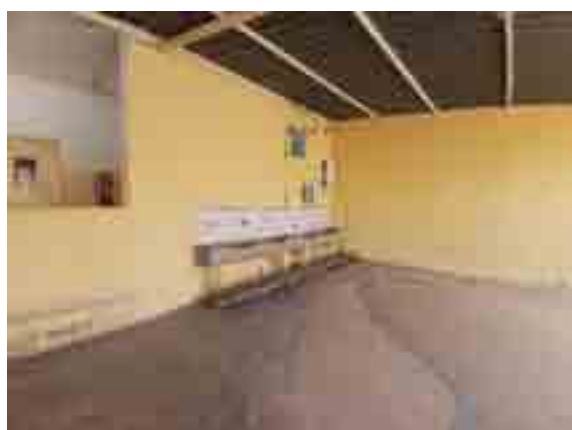

School No.	School Name	CERD No.	Governorate / District
61	Kfartoun Public School ثانوية كفرتون الرسمية	1490	Akkar

School Location:	X	Y
	34.5612096	36.3569755

School Information:	Owned	Rented	No. of Blocks:	1
		✓		
	No. of Floors:	3	No. of Classrooms:	17

Director Name and Contact:	Khaled Yaasine El Adraa	- Landline:	06-850218
		- Mobile:	70-450635

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
	✓		Not operating	Good	To Repair
					✓
Roof Waterproofing:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Playground:	Yes	No	Comments	Condition	
	✓		Type: Concrete	Good	To Repair
				✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Tiles	Good	To Repair
					✓
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: steel	Good	To Repair
					✓
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: steel	Good	To Repair
					✓
Shed:	Yes	No	Comments	Condition	
	✓		Type Zinc (TOT) – Resin (Plastic)	Good	To Repair
				✓	
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
					✓
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Source of Electricity:	EDL		Generator	Condition	
	✓			Good	To Repair
				✓	


Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
61	Kfartoun Public School ثانوية كفرتون الرسمية	1490	Akkar



School No.	School Name	CERD No.	Governorate / District
61	Kfartoun Public School ثانوية كفرتون الرسمية	1490	Akkar

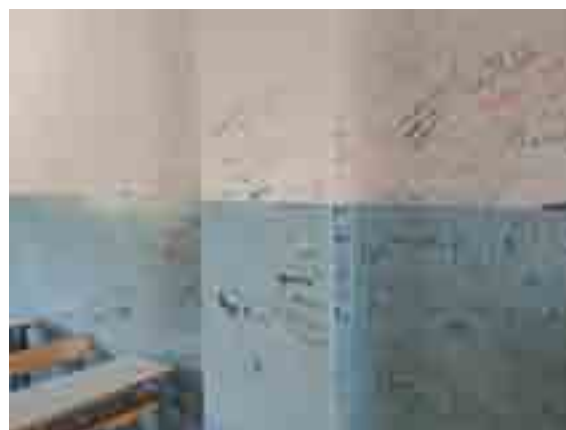

School No.	School Name	CERD No.	Governorate / District
61	Kfartoun Public School ثانوية كفرتون الرسمية	1490	Akkar



School No.	School Name	CERD No.	Governorate / District
62	El awadeh Public School مدرسة العوادة الرسمية	1550	Akkar

School Location:	X	Y
	34.6253629	36.3795962

School Information:	Owned	Rented	No. of Blocks:	2
		✓		
	No. of Floors:	A:2,B:1	No. of Classrooms:	17

Director Name and Contact:	Mohammad El Dandanchi	- Landline:	
		- Mobile:	71-681857

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Roof Waterproofing:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Playground:	Yes	No	Comments	Condition	
	✓		Type: concrete	Good	To Repair
				✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: 24 panels	Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
	✓		Type: Sandwish panel	Good	To Repair
				✓	
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Source of Electricity:	EDL		Generator	Condition	
	✓			Good	To Repair
				✓	

Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
62	El Awadeh Public School مدرسة العوادة الرسمية	1550	Akkar



School No.	School Name	CERD No.	Governorate / District
62	El Awadeh Public School مدرسة العوادة الرسمية	1550	Akkar



School No.	School Name	CERD No.	Governorate / District
63	El Bkayieh Mixed Public School مدرسة البقعة الرسمية المختلطة	1553	Akkar

School Location:	X	Y
	34.6628018	36.3320865

School Information:	Owned	Rented	No. of Blocks:	1
		✓		
	No. of Floors:	2	No. of Classrooms:	18

Director Name and Contact:	Basima Kasem	- Landline:	06-860290
		- Mobile:	76-381373

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Roof Waterproofing:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Playground:	Yes	No	Comments	Condition	
	✓		Type: concrete	Good	To Repair
				✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Tiles	Good	To Repair
				✓	

External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	

Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	

Shed:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

PV Solar Panel at Roof:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Source of Electricity:	EDL		Generator	Condition	
	✓		✓	Good	To Repair
				✓	

Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
63	El Bkayieh Mixed Public School مدرسة البقعة الرسمية المختلطة	1553	Akkar



School No.	School Name	CERD No.	Governorate / District
63	El Bkayieh Mixed Public School مدرسة البقيعة الرسمية المختلطة	1553	Akkar



School No.	School Name	CERD No.	Governorate / District
70	Sandiyanit Zeidan Public School ثانوية سنديانة زيدان الرسمية	1637	Akkar

School Location:	X	Y
	34.5815071	36.2444232

School Information:	Owned	Rented	No. of Blocks:	1
	✓			
	No. of Floors:	2	No. of Classrooms:	7

Director Name and Contact:	Amer Hamad	- Landline:	06-830540
		- Mobile:	03-767308

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Roof Waterproofing:	Yes	No	Comments	Condition	
	✓		Type: PU	Good	To Repair
				✓	

Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair

Playground:	Yes	No	Comments	Condition	
	✓		Slab on grade	Good	To Repair
				✓	

Drinking Fountain:	Yes	No	Comments	Condition	
		✓		Good	To Repair
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: steel	Good	To Repair
				✓	
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: steel	Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Source of Electricity:	EDL		Generator	Condition	
	✓		✓	Good	To Repair
				✓	

Remarks:

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation works that can be addressed without structural intervention and fall within the intended scope of the current assignment.

School No.	School Name	CERD No.	Governorate / District
70	Sandiyanit Zeidan Public School ثانوية سنديانة زيدان الرسمية	1637	Akkar



School No.	School Name	CERD No.	Governorate / District
70	Sandiyanit Zeidan Public School ثانوية سنديانة زيدان الرسمية	1637	Akkar



School No.	School Name	CERD No.	Governorate / District
79	El Bireh Public School تكميلية البيرة الرسمية	589	Akkar

School Location:	X	Y
	34.5869998	36.2332421

School Information:	Owned	Rented	No. of Blocks:	1
	✓			
	No. of Floors:	2	No. of Classrooms:	20

Director Name and Contact:	Ahmad Al Moraabi	- Landline:	26-830238
		- Mobile:	03-459478

Building Condition: Category **1**

Roof Heat Insulation:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Roof Waterproofing:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Presence of Parapet at Roof Floor:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Presence of Handicap Ramp at GF level:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Presence of Handicap Toilet:	Yes	No	Comments	Condition	
		✓		Good	To Repair
Playground:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	

Drinking Fountain:	Yes	No	Comments	Condition	
	✓		Type: Resin	Good	To Repair
				✓	
External Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Internal Main Gate:	Yes	No	Comments	Condition	
	✓		Type: Steel	Good	To Repair
				✓	
Shed:	Yes	No	Comments	Condition	
	✓		Type: Zinc	Good	To Repair
				✓	
Rain Water System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Waste Water Drainage System:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Electrical System:	Yes	No	Comments	Condition	
	✓		Panel board configuration	Good	To Repair
					✓
PV Solar Panel at Roof:	Yes	No	Comments	Condition	
	✓			Good	To Repair
				✓	
Source of Electricity:	EDL		Generator	Condition	
	✓		✓	Good	To Repair
				✓	

Remarks:

El Bireh intermediate School (CERD 589) shares the same structure with Al-Bireh Secondary School (CERD 590), although the two schools are separated by an internal steel door.

Based on the visual site assessment, the school is classified as **Category 1**, as the identified needs are limited to minor rehabilitation and maintenance works that do not require structural intervention.

School No.	School Name	CERD No.	Governorate / District
79	El Bireh Public School تكميلية البيرة الرسمية	589	Akkar



School No.	School Name	CERD No.	Governorate / District
79	El Bireh Public School تكميلية البيرة الرسمية	589	Akkar

